



713-730-3151

www.a-actionhouston.com

Info@aactionhouston.com



INSPECTED FOR

Heather Baldwin
1620 Elgin St. Unit 9
Houston, TX 77004

March 18, 2026



PROPERTY INSPECTION REPORT FORM

Heather Baldwin

Name of Client

03/18/2026

Date of Inspection

1620 Elgin St. Unit 9, Houston, TX 77004

Address of Inspected Property

Tyler Bauer

Name of Inspector

24097-PI

TREC License #

Name of Sponsor (if applicable)

TREC License #

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. *It is important* that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILITY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

Conditions may be present in your home that did not violate building codes or common practices in effect when the home was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed or missing ground fault circuit protection (GFCI) devices and arc-fault devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as, smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Inspection Time In: **1:45 pm** Time Out: **3:30 pm** Property was: **Vacant**
Building Orientation (For Purpose Of This Report Front Faces): **South**
Weather Conditions During Inspection: **Sunny**
Outside Temperature During Inspection: **60 ° to 70 ° Degrees**
Parties Present at Inspection: **Buyers Agent**

THIS REPORT IS PAID AND PREPARED FOR THE EXCLUSIVE USE BY Heather Baldwin. THIS COPYRIGHTED REPORT IS NOT VALID WITHOUT THE SIGNED INSPECTION AGREEMENT.

THIS REPORT IS NOT TRANSFERABLE FROM CLIENT NAMED ABOVE.

SCOPE OF INSPECTION

These standards of practice define the minimum levels of inspection required for substantially completed residential improvements to real property up to four dwelling units. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the client with information regarding the general condition of the residence at the time of inspection. The inspector may provide a higher level of inspection performance than required by these standards of practice and may inspect components and systems in addition to those described by the standards of practice.

GENERAL LIMITATIONS

The inspector is not required to:

(A) inspect:

- (i) items other than those listed within these standards of practice;
- (ii) elevators;
- (iii) detached buildings, decks, docks, fences, or waterfront structures or equipment;
- (iv) anything buried, hidden, latent, or concealed;
- (v) sub-surface drainage systems;
- (vi) automated or programmable control systems, automatic shut-off, photoelectric sensors, timers, clocks, metering devices, signal lights, lightning arrestor system, remote controls, security or data distribution systems, solar panels, outdoor kitchens, gas grills (built-in or free standing), refrigerators (built-in or free standing), wine coolers, ice makers or smart home automation components; or
- (vii) concrete flatwork such as; driveways, sidewalks, walkways, paving stones or patios;

(B) report:

- (i) past repairs that appear to be effective and workmanlike except as specifically required by these standards;
- (ii) cosmetic or aesthetic conditions; or
- (iii) wear and tear from ordinary use;

(C) determine:

- (i) insurability, warrantability, suitability, adequacy, compatibility, capacity, reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, life expectancy, age, energy efficiency, vapor barriers, thermostatic performance, compliance with any code, listing, testing or protocol authority, utility sources, or manufacturer or regulatory requirements except as specifically required by these standards;
- (ii) the presence or absence of pests, termites, or other wood-destroying insects or organisms;
- (iii) the presence, absence, or risk of asbestos, lead-based paint, **MOLD**, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, or poison;
- (iv) types of wood or preservative treatment and fastener compatibility; or
- (v) the cause or source of a conditions;

(D) anticipate future events or conditions, including but not limited to:

- (i) decay, deterioration, or damage that may occur after the inspection;
- (ii) deficiencies from abuse, misuse or lack of use;
- (iii) changes in performance of any component or system due to changes in use or occupancy;
- (iv) the consequences of the inspection or its effects on current or future buyers and sellers;
- (v) common household accidents, personal injury, or death;
- (vi) the presence of water penetrations; or
- (vii) future performance of any item;

(E) operate shut-off, safety, stop, pressure or pressure-regulating valves or items requiring the use of codes, keys, combinations, or

- similar devices;
- (F) designate conditions as safe;
 - (G) recommend or provide engineering, architectural, appraisal, mitigation, physical surveying, realty, or other specialist services;
 - (H) review historical records, installation instructions, repair plans, cost estimates, disclosure documents, or other reports;
 - (I) verify sizing, efficiency, or adequacy of the ground surface drainage system;
 - (J) verify sizing, efficiency, or adequacy of the gutter and downspout system;
 - (K) operate recirculation or sump pumps;
 - (L) remedy conditions preventing inspection of any item;
 - (M) apply open flame or light a pilot to operate any appliance;
 - (N) turn on decommissioned equipment, systems or utility services; or
 - (O) provide repair cost estimates, recommendations, or re-inspection services.

THE CLIENT, BY ACCEPTING THIS PROPERTY INSPECTION REPORT OR RELYING UPON IT IN ANY WAY, EXPRESSLY AGREES TO THE SCOPE OF INSPECTION, GENERAL LIMITATIONS AND INSPECTION AGREEMENT INCLUDED IN THIS INSPECTION REPORT.

This inspection report is made for the sole purpose of assisting the purchaser to determine his and/or her own opinion of feasibility of purchasing the inspected property and does not warrant or guarantee all defects to be found. If you have any questions or are unclear regarding our findings, please call our office prior to the expiration of any time limitations such as option periods.

This report contains technical information. If you were not present during this inspection, please call the office to arrange for a consultation with your inspector. If you choose not to consult with the inspector, this inspection company cannot be held liable for your understanding or misunderstanding of the reports content.

The contents of this report are for the sole use of the client named above and no other person or party may rely on this report for any reason or purpose whatsoever without the prior written consent of the inspector who authored the report. Any person or party who chooses to rely on this report for any reason or purpose whatsoever without the express written consent of the inspector does so at their own risk and by doing so without the prior written consent of the inspector waives any claim of error or deficiency in this report.

This report is not intended to be used for determining insurability or warrantability of the structure and may not conform to the Texas Department of Insurance guidelines for property insurability. *This report is not to be used by or for any property and/or home warranty company.*

The digital pictures within this report are a representative sample of inaccessible areas, deficiencies or damages in place and should not be considered to show all of the inaccessible areas, deficiencies or damages observed. There will be inaccessible areas, deficiencies or damages not represented with digital imaging.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

I. STRUCTURAL SYSTEMS

A. Foundations

Type of Foundation(s): Slab on Ground

Comments:

Foundation Is Performing Adequately

In my opinion, the foundation appears to be providing adequate support for the structure at the time of this inspection. I did not observe any apparent evidence that would indicate the presence of adverse performance or significant deficiencies in the foundation. The interior and exterior stress indicators showed little effects of adverse performance and I perceived the foundation to contain no significant unlevelness.

Additional Observations and/or Comments:

Note: Due to the nature of this property (condominium, apartment, or multi-story structure), a comprehensive evaluation of the entire foundation is beyond the scope of this inspection. If there are any concerns regarding the foundation or structural performance, it is recommended to consult a licensed structural engineer for a full assessment.

Notice: This inspection is one of first impression and the inspector was not provided with any historical information pertaining to the structural integrity of the inspected real property. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection. The inspection of the foundation may show it to be providing adequate support for the structure or having movement typical to this region, at the time of the inspection. This does not guarantee the future life or failure of the foundation. ***The Inspector is not a structural engineer. This inspection is not an engineering report or evaluation and should not be considered one, either expressed or implied.*** If any cause of concern is noted on this report, or if you want further evaluation, you should consider an evaluation by an engineer of your choice.

B. Grading and Drainage

Comments:

Grading & Drainage

Note: The grading/drainage was not inspected due to the type of structure and property.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

C. Roof Covering Materials

Type(s) of Roof Covering: Composition

Viewed From: Drone, Juliet Balcony

Comments:


Roof Covering

You are strongly encouraged to have a professional roofing contractor conduct a physical inspection of the roof prior to the expiration of any time limitations, such as option or warranty periods. This will ensure a complete evaluation of the roofing material's condition. The observations supporting this recommendation include, but are not limited to, the following:

- Missing shingles were observed on the south side of the roof structure. Missing shingles expose the underlayment or decking to the elements, increasing the risk of moisture intrusion and potential damage to the roof structure. Recommend evaluation and repair by a professional roofing contractor to restore missing shingles to ensure proper weather protection.
- The composition roofing material shows granular loss in multiple areas across the roof. Granule loss can reduce the roof's ability to protect against UV damage and water intrusion, potentially shortening its lifespan. Recommend evaluation by a professional roofing contractor to determine the extent of deterioration and necessary repairs or replacement.

Note: Due to the limited nature of a general home inspection, it is possible that additional deficiencies will be discovered by a professional roofing contractor. It is recommended to have the system further evaluated prior to the expiration of any option/warranty period.

Note: The inspector inspected the roof with a drone due to the height and structure type. The drone will help identify major issues but cannot detect the smaller deficiencies that can be identified by walking the structure.

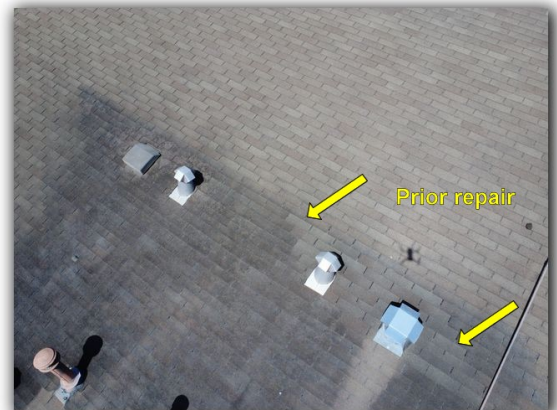

I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Additional Photos:

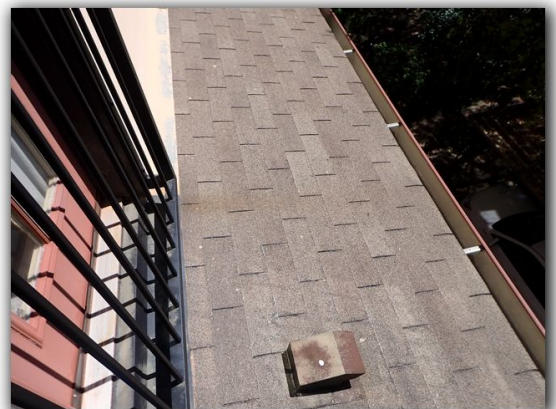



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

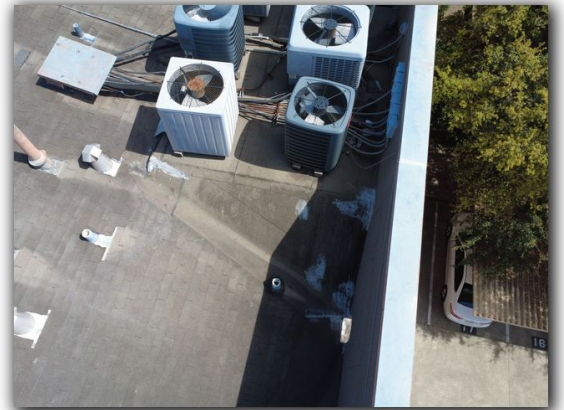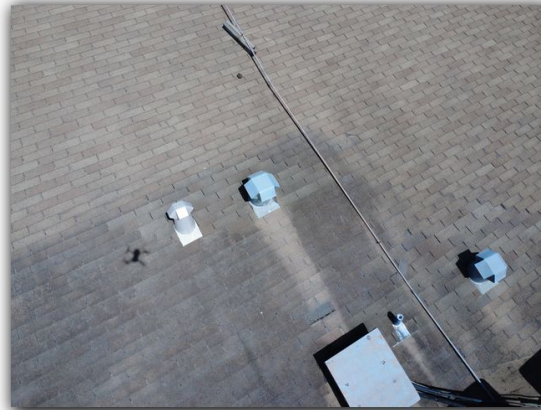

Flashing Details

- It is recommended to paint the flashing to help prevent rust and protect against UV damage. Proper maintenance of flashing can extend its service life and help maintain the roof's overall integrity. Recommend evaluation and painting by a qualified contractor.
- Some metal flashing details were observed to have surface rust. Rust can deteriorate the flashing over time, potentially compromising the roof's watertight integrity. It is recommended to have a professional roofing contractor evaluate the condition and perform necessary maintenance or repairs to prevent further damage.

Note: The inspector inspected the roof with a drone due to the height and structure type. The drone will help identify major issues but cannot detect the smaller deficiencies that can be identified by walking the structure.



I=Inspected


NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

Additional Photos:

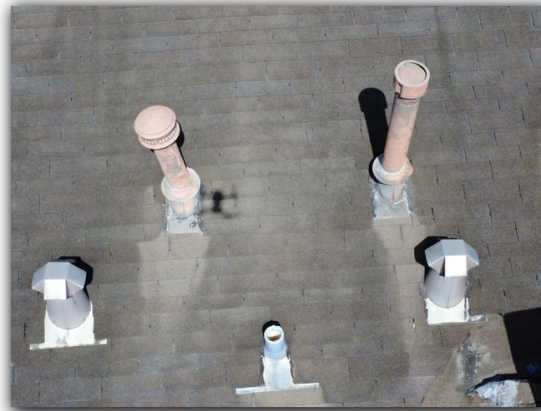

Notice: Life expectancy of the roofing material is not covered by this property inspection report. If any concerns exist about the roof covering life expectancy or potential for future problems, a roofing specialist should be consulted. The Inspector cannot offer an opinion or warranty as to whether the roof has leaked in the past, leaks now, or may be subject to future leaks, either expressed or implied.

The inspection of this roof may show it to be functioning as intended or in need of minor repairs. This inspection does not determine the insurability of the roof. You are strongly encouraged to have your Insurance Company physically inspect the roof, prior to the expiration of any time limitations such as option or warranty periods, to fully evaluate the insurability of the roof.

-
-
-
-

D. Roof Structures and Attics

Viewed From: Attic Decked Space Only

Approximate Average Depth of Insulation: Unable to determine.

(**Note:** Generally recommended depth of attic floor insulation is approximately 10+ inches to achieve a R30 rating.)

Insulation Type: Unable To Determine

Description of Roof Structure: Unable To Determine

Attic Accessibility: Partial

Comments:

Roof Structure

Note: The roof structure framing was not fully visible due to the attic design.

I=Inspected

NI=Not Inspected

NP=Not Present


D=Deficient

I	NI	NP	D
---	----	----	---



Attic Fireblocking

- There is inadequate fireblock separation between the units. A complete vertical and a four-foot (4-ft.) horizontal fireblock separation of a two-family dwelling are required at the line of dwelling unit separation.

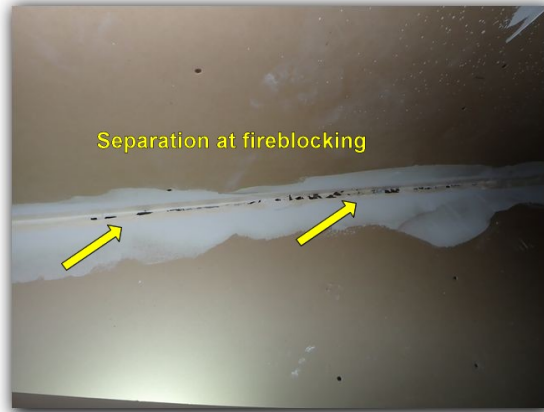

Attic Ventilation

All components were found to be performing and in satisfactory condition on the day of the inspection.

Attic Insulation

Note: No attic insulation was visible at the time of inspection due to the attic design.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



Attic Ladder/Hatch Opening

- The attic ladder does not close completely. The underlying cause should be evaluated and repairs made as necessary to ensure proper operation and safety.
- Surface damage was observed on the face of the attic ladder door.
- Some of the attic ladder nuts and bolts were observed to be loose and/or missing. For safety reasons, it is recommended to secure or replace these fasteners and ensure the attic ladder is properly stabilized.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

E. Walls (Interior and Exterior)

Comments:

Description of Exterior Cladding: Brick Veneer, Fiber Cement Board, Wood Type Veneer

Interior Walls & Surfaces

- Joint cracks were observed in the interior walls of several locations throughout the house. These cracks typically indicate normal seasonal expansion and contraction.
- Water staining and/or damage was observed on the baseboards in several locations throughout the house. It is recommended to investigate the cause and address any necessary repairs to prevent further damage.
- Cabinet surface damage was observed in the primary bathroom.
- Stress cracks were observed in the interior walls of the third floor loft area. These cracks may indicate abnormal settling or movement.

Notice: The inspector was unable to inspect all of the interior surfaces because of window treatments, personalized wall treatments / finishes, personal effects, large, heavy or fragile storage and/or furniture.
Note: There is evidence of painting and patching to the interior finish and prior interior finish repairs. This condition could limit the Inspectors visual observations and ability to render accurate opinions as to the performance of the structure.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



Additional Photos:



Exterior Walls & Surfaces

- Deterioration or damage was observed in the wood veneer trim on the south side of the structure. It is recommended to repair or replace affected areas to prevent further deterioration and maintain the trim's appearance and function.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



F. Ceilings and Floors

Comments:

Ceilings

- Water stains were observed on the ceiling(s) in the kitchen, second floor loft area. It is recommended to identify and address the source of moisture (if necessary) to prevent further damage.
- Water stains observed on the ceiling at and/or around the water heater flue area. The sealant at the flue roof level storm collar needs to be further investigated and corrected as necessary.
- Joint cracks were observed in the ceilings of the primary bathroom, second floor loft area. These cracks typically indicate normal seasonal expansion and contraction.

Note: There is evidence of painting and patching to the interior finish and prior interior finish repairs. This condition could limit the Inspectors visual observations and ability to render accurate opinions as to the performance of the structure.




I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

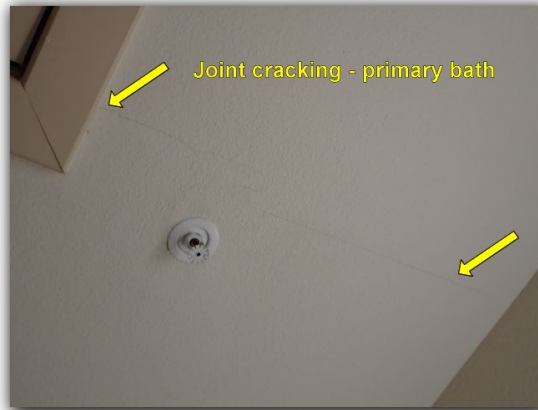

I=Inspected

NI=Not Inspected

NP=Not Present


D=Deficient

I	NI	NP	D
---	----	----	---

Floors

- The floor covering was observed to be damaged in the kitchen.
- The floor tile(s) were observed to be cracked and/or damaged in the laundry room, half bathroom.
- Loose floor tiles were observed in the following area(s): laundry room. This condition may indicate issues with the original installation, such as inadequate adhesive or improper substrate preparation, and can lead to further tile damage or present a tripping hazard. It is recommended to have a qualified flooring contractor assess and properly re-secure or replace the affected tiles to prevent future deterioration.
- The floor tile grout was observed to be damaged and/or missing in the laundry room, primary bathroom.

Note: The upstairs sub-floor (flooring) is noisy when walked over in one or more locations.

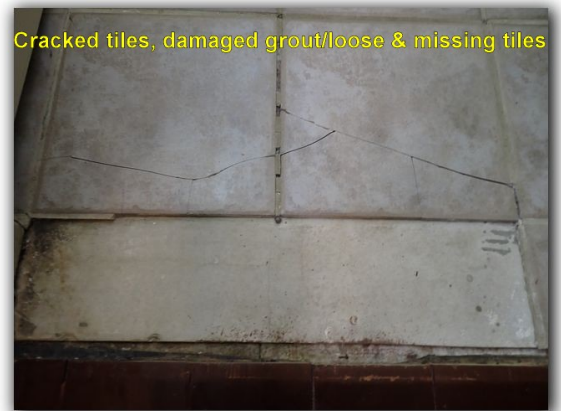

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



G. Doors (Interior and Exterior)

Comments:

Interior Doors

- The door contacts the floor during operation to the primary bathroom toilet closet. Adjustments are recommended to restore intended operation to the door and prevent floor covering damage.
- The door at the following location(s): front entry closet, is not latching properly. This may be due to misalignment, worn hardware, and/or damage to the latch mechanism, which can affect functionality.



Exterior Doors

- Weather-stripping improvements are recommended for the following exterior door(s): front entry, balcony entry. Upgrading or repairing weather-stripping can help improve energy efficiency by reducing air infiltration and protect against moisture intrusion.
- The door at the following location(s): balcony door, is sticking, making it difficult to open or close smoothly. This issue may be caused by swelling due to moisture, misalignment, or worn hardware.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



H. Windows

Comments:

Window Screens

- One or more of the window screens were observed to be damaged.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

Windows

- Water stains were observed at and/or around the window(s) in the following area(s): North side windows. This may indicate past or ongoing moisture intrusion. The source of the staining should be investigated by a qualified professional, and appropriate repairs made to prevent further damage and ensure the area remains dry.
- The window guide is damaged in the following area(s): primary bedroom, third floor loft area, causing the window to not stay in the open position. This condition affects window functionality. It is recommended to have a qualified professional repair or replace the damaged guide to restore proper operation.
- The window sill(s) finish in the following area(s): several locations throughout the house, show signs of deterioration and/or damage. This may be due to moisture intrusion, age, or general wear and tear.
- One or more windows in the following area(s): third floor loft area, are stiff and difficult to operate. This may be due to issues such as swelling, damaged hardware, or lack of maintenance. It is recommended to have the windows inspected and serviced by a qualified professional to restore smooth and safe operation.
- The weather-stripping is damaged and/or missing at one or more windows. This condition can lead to air/water intrusion and reduced energy efficiency. It is recommended to repair or replace the weather-stripping to improve sealing and overall window performance.

Note: I was unable to visually inspect or operate of some of the windows due to height, window treatments, personal effects, large, heavy or fragile storage and/or furniture.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



I. Stairways (Interior and Exterior)

Comments:

- One or more of the steps were observed to be damaged.
- The center support was observed to be canted to the right between the second and third floor. The stairway treads were still supported and did not give under normal traffic up and down the stairs. This condition should be monitored over time and corrected as necessary.

I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Additional Photos:

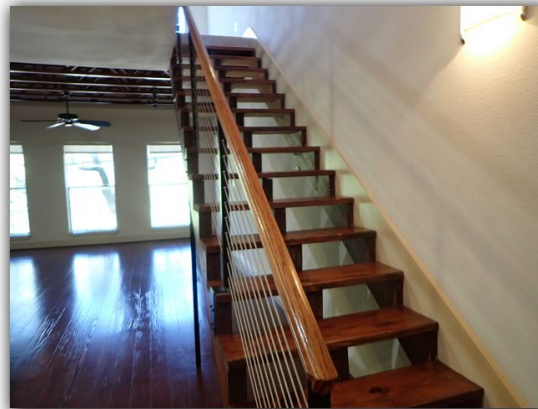

J. Fireplaces and Chimneys

Comments:

Note: There is no fireplace present on the structure at the time of inspection.

K. Porches, Balconies, Decks, and Carports

Comments:

Note: The unit is not equipped with a porch, balcony, deck, or carport.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

Comments:



Sub Panel Box

Box Location: Laundry Room

Cabinet Manufacturer: Cutler-Hammer

Branch Circuit Wire Type: Copper

- The electrical cabinet cover plate (dead front) should be secured using blunt-tip screws rather than pointed tip screws to enhance safety and prevent potential damage.
- In the sub-panel electrical cabinet, the ground and neutral wires are not properly separated. According to current National Electrical Code (NEC) standards, neutral conductors in a sub-panel should be isolated on a separate bus bar, while ground conductors should be bonded to the panel cabinet. Although the sub-panel may appear functional, this configuration does not meet current code requirements and should be evaluated and corrected by a licensed electrician.

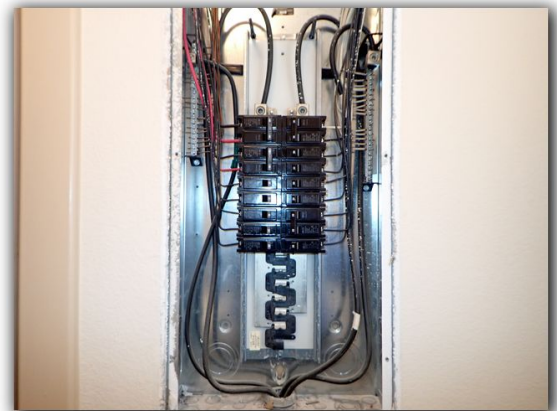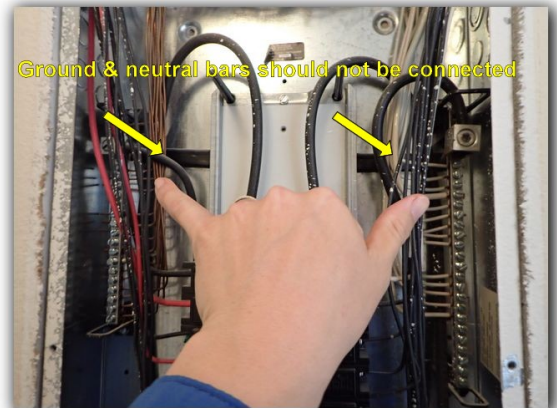





I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

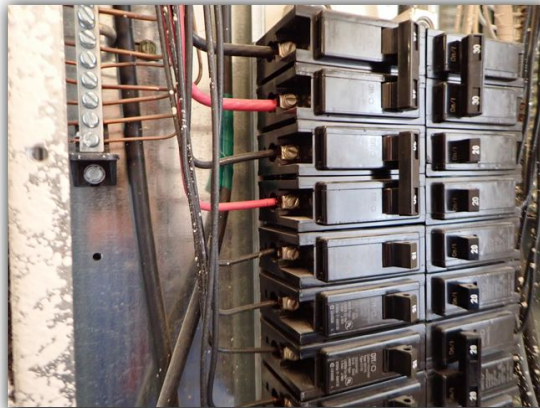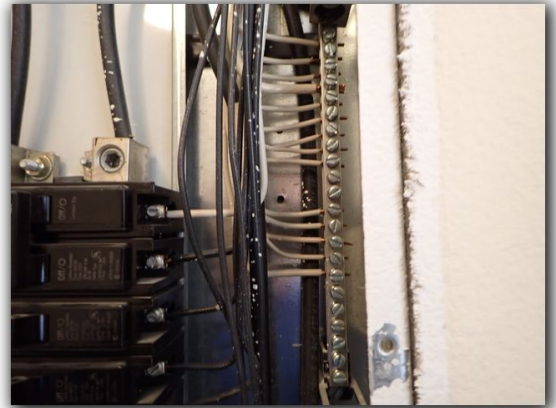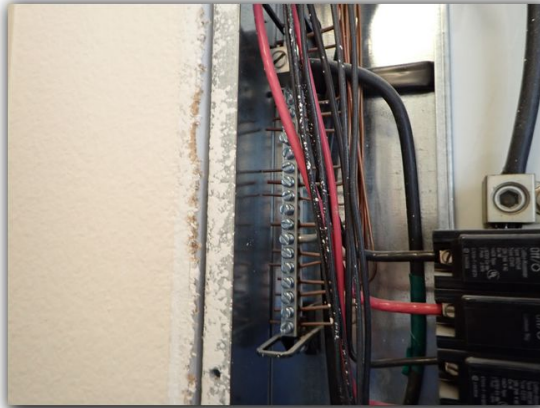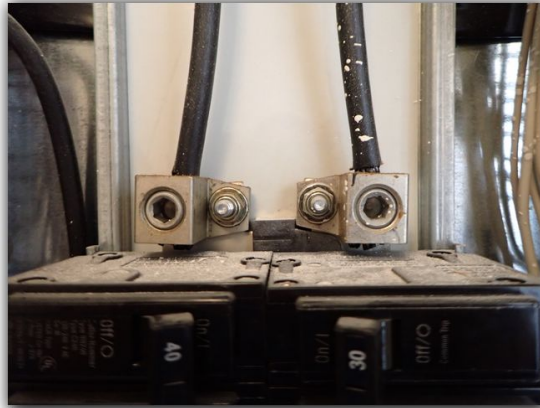



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

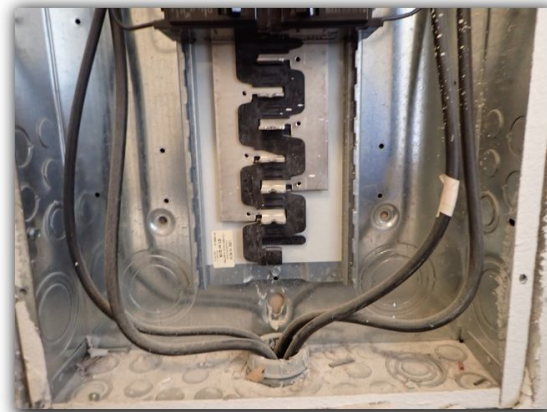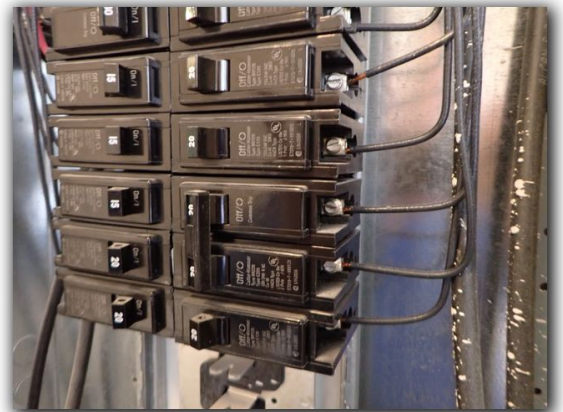

Arc-Fault Circuit Interrupter Protection (AFCI)

- None of the required dwelling unit devices, receptacle and lighting outlets (switches, receptacles and fixtures) are connected to an arc-fault circuit-interrupter (AFCI) circuit device. AFCI devices were first required under the 1999 National Electrical Code and under the 2014 NEC, all living space, kitchen and laundry room devices, receptacle and lighting outlets (switches, receptacles and fixtures) should be connected to an arc-fault circuit interrupter (AFCI) device.

Grounding / Bonding

- The electrical bonding connection between the gas piping and the grounding electrode system was not located at the time of inspection. Bonding connections should be accessible for inspection, repair, or replacement. Recommend further evaluation by a qualified electrician to verify proper bonding and correct if necessary.
- The electrical bonding connection between the metal water piping and the grounding electrode system was not visible at the time of inspection. Bonding connections should be accessible for inspection, repair, or replacement. Recommend further evaluation by a qualified electrician to confirm proper bonding and make corrections if needed.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Distribution Wiring

- Exposed wires were observed in the front entry closet. For safety, all open end wires should be properly enclosed within approved junction boxes.



B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring: Copper

Comments:

Receptacle Outlets

- The laundry room area receptacles are not connected to a ground fault circuit interrupter (GFCI) device. Under current electrical standards, all of the receptacles in the laundry room area should have GFCI protection.

Note: Some of the receptacles in the home were inaccessible and could not be reached for inspection due to height, personal effects, heavy storage, furniture or conditions outside the control of the inspector.


I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

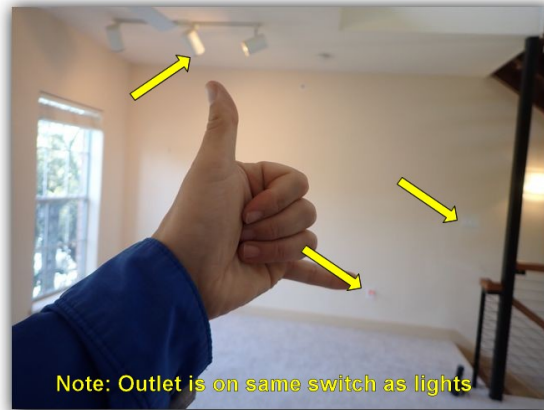

Arc-Fault Circuit Interrupter Protection (AFCI)

- None of the required dwelling unit devices, receptacle and lighting outlets (switches, receptacles and fixtures) are connected to an arc-fault circuit-interrupter (AFCI) circuit device. AFCI devices were first required under the 1999 National Electrical Code and under the 2014 NEC, all living space, kitchen and laundry room devices, receptacle and lighting outlets (switches, receptacles and fixtures) should be connected to an arc-fault circuit interrupter (AFCI) device.

Switches

All components were found to be performing and in satisfactory condition on the day of the inspection.

Fixtures

- One or more light fixtures in the primary bedroom closet are not functioning properly. Recommend evaluation and repair or replacement as necessary by a qualified technician.
- The ceiling fan in the living room, third floor loft area is not properly balanced and wobbles when operated. Recommend adjustment or servicing to ensure safe and smooth operation.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



Smoke & Carbon Monoxide Alarms

- I was unable to locate a carbon monoxide alarm in the immediate vicinity of all the bedrooms.
- The smoke alarms present at the time of inspection are older. Most manufacturers recommend replacing smoke alarms every 10 years for safety. It is recommended to replace these alarms to ensure protection.
- One or more smoke alarms are loose at their mounting in the second to third floor stairway. Recommend securing them properly to ensure reliable operation.

Note: It is recommended to replace the batteries in all of the smoke detectors once a year for reasons of safety.

Note: Due to location, height or conditions outside the control of the inspector, one or more of the smoke alarms were inaccessible and could not be tested at the time of this inspection.




I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

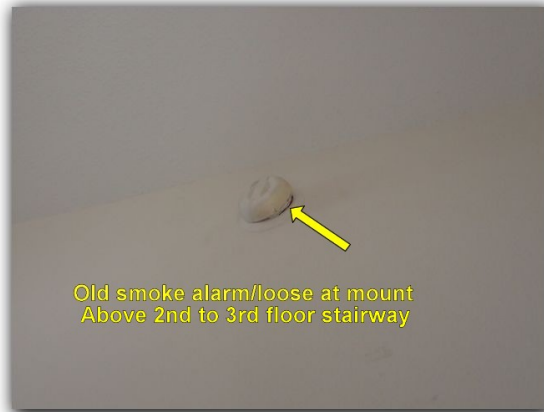

Doorbell / Chime

Note: A smart or camera-style doorbell is installed. The inspector may not be able to test the doorbell chime because the upgraded system may bypass the traditional chime component.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

A. Heating Equipment

Type of Systems:

Energy Sources:




Comments:

Central Heating System – Energy Source: Electric/Water
Brand Name: Aqua Therm

It is advised that the HVAC system be checked and serviced by a qualified, licensed HVAC technician. The system showed conditions that warrant further evaluation. The observations supporting this recommendation include, but may not be limited to, the following:

- The heating equipment was found to be inoperative at the time of the inspection. The system did not respond to normal operating controls.
- The air filter is dirty and should be replaced to ensure optimal system performance and air quality.
- A service disconnect was not located or observed at or near the heating unit. Recommend further evaluation and installation of an appropriate disconnect by a qualified electrician or HVAC technician.

Note: Due to the limited scope of a general home inspection, additional deficiencies may be identified by a licensed HVAC technician during a full service evaluation. It is recommended that the system be serviced prior to the expiration of any option or warranty period.

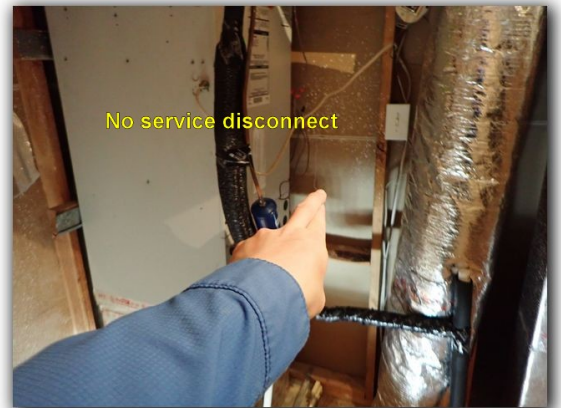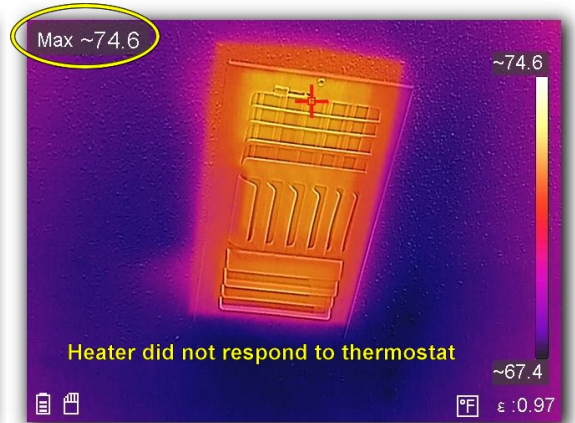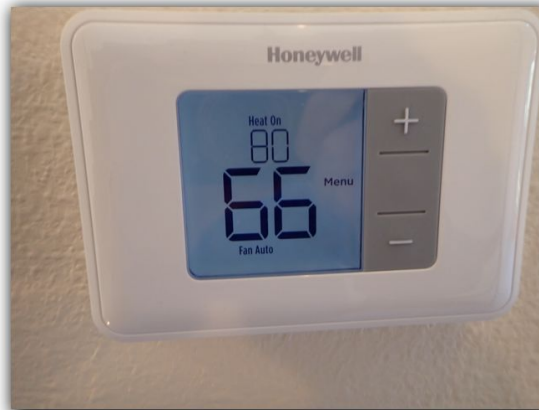



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

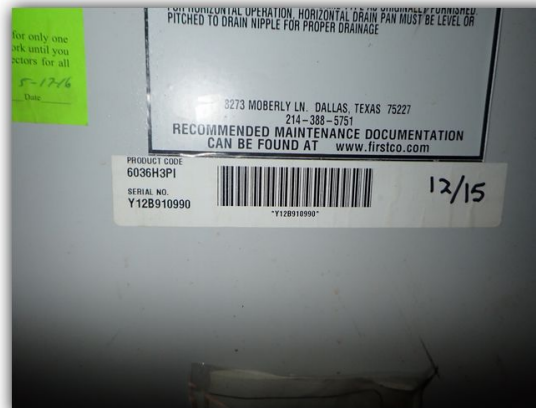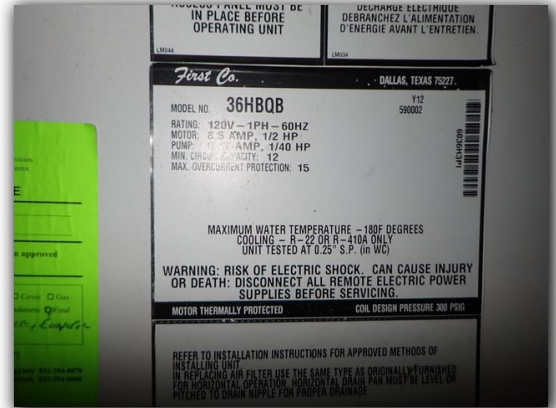

-
-
-
-

B. Cooling Equipment

Type of Systems:

Comments:

Central Cooling System

Today's Temperature Differential (Delta-T): 17

Approximate System Age: **2015 Coil / Unable to View Condenser**

Approximate System Size: **3 ton**

Brand Name: **Unable To Determine**

Freon Type: **R-410A**

Humidity % **~50%**

Notice: The condenser unit is located on the rooftop and was inaccessible at the time of inspection. As a result, the unit could not be visually inspected. If there are any concerns regarding its age, condition, or performance, a licensed HVAC technician should be consulted for further evaluation.

- The air filter is dirty and should be replaced to ensure optimal system performance and air quality.
- The air return is in a difficult location to access. A ladder will be needed to change the air filter.
- The equipment is sitting inside the secondary condensate drain pan below the flood rim. This installation does not meet current mechanical standards. The equipment should be elevated on a water-resistant support above the pan's flood rim.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



Notice: Temperature differential readings (Delta-T) are an accepted industry standard of practice for testing the proper operation of the cooling system. Our company policy normal acceptable range is considered approximately **between 15 to 20 degrees °F** total difference (Delta-T) measured between the return air and supply air within close proximity of the related coils of the system being evaluated. Conditions such as but not limited to; excessive humidity, high or low outdoor temperatures or restricted airflow may indicate abnormal operation even through the equipment is functioning basically as designed and occasionally may indicate normal operation in spite of an equipment malfunction. ***The inspector will not be able to anticipate future events, conditions or changes in performance of any component or***

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.

C. Duct Systems, Chases, and Vents

Comments:

- The duct work in the attic area is not properly separated to help prevent condensation from developing. It is recommended to separate the duct work with a minimum intervals of 1.5-inches.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

IV. PLUMBING SYSTEMS

A. Plumbing Supply, Distribution Systems and Fixtures

Location of water meter: Within 5-feet of Front Curb

Location of main water supply valve: Front Entry Closet

Static water pressure reading: 40 to 50 psi

Type of supply piping material: Copper

Comments:

Water Supply System

All components were found to be performing and in satisfactory condition on the day of the inspection.



Exterior Faucets/Fixtures

All components were found to be performing and in satisfactory condition on the day of the inspection.

Laundry Connections

All components were found to be performing and in satisfactory condition on the day of the inspection.



Kitchen Sink

- The sprayer head is not functioning properly. Evaluation and repair or replacement by a qualified professional is recommended.
- The faucet neck is loose.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient


I	NI	NP	D
---	----	----	---



Half Bathroom

Lavatory / Sink

- The sink stopper does not function properly.

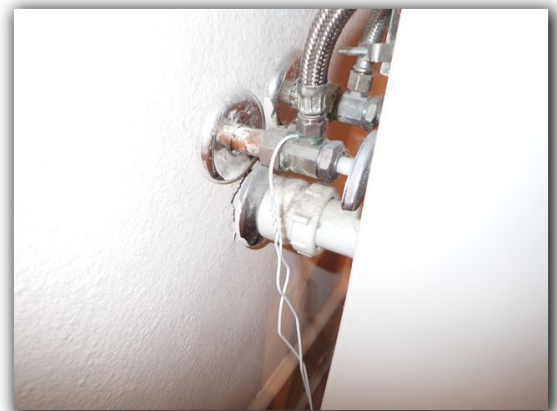

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



Primary Bathroom

Left Lavatory / Sink

- The faucet leaks back through the aerator during operation.

Right Lavatory / Sink

- The sink drain is leaking water into the cabinet. Evaluation and repair or replacement by a qualified plumber is recommended.
- The sink stopper does not function properly.
- The faucet leaks back through the aerator during operation.
- The faucet leaks at the base when operated. Evaluation and repair or replacement by a qualified professional is recommended.

Bathtub

- The tub spout is not properly sealed at the wall. This condition could allow water to leak into the wall cavity and should be repaired by a qualified professional.
- Cracked, deteriorated, or missing grout and/or caulking should be repaired or replaced as necessary to prevent water intrusion and damage.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



Notice: The Inspector has attempted to discover and report conditions requiring further evaluation or repair. However; determining the condition of any component that is not visible and/or accessible, such as plumbing components that are buried, beneath the foundation, located within construction voids or otherwise concealed, and reporting any deficiency that does not appear or become evident during our limited cursory and visual survey is outside the scope of this inspection. **The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.**

-
-
-
-

B. Drains, Wastes, and Vents

Type of drain piping material: PVC

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

Notice: Reporting the condition of drains, wastes and vent piping that is not completely visible and/or accessible or; reporting any defect or deficiency that requires extended use of the system to develop or does not become evident during our limited cursory and visual survey is outside the scope of the inspection. This is a limited cursory and visual survey of the accessible general conditions and circumstances present at the time of this inspection. Opinions are based on general observations made without the use of specialized tools or procedures. Therefore, the opinions expressed are one of apparent conditions and not of absolute fact and are only good for the date and time of this inspection. **The inspector will not be able to anticipate future events, conditions or changes in performance of any component or system due to changes in use or occupancy. The inspector makes no guarantee or warranty, express or implied, as to future performance of any item, system or component.**

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

C. Water Heating Equipment

Energy Sources:

Capacity:

Comments:

Water Heater – *Energy Source: Gas*

Location: Attic

Approximate Capacity: 50 Gallons

Approximate Age: 2021

Brand Name: Rheem

- Some corrosion was observed at the water supply connections on top of the water heater. Further evaluation and maintenance or repair by a qualified plumber is recommended to prevent leaks or failure.
- The roof-level flue storm collar should be properly sealed to prevent water intrusion into the structure. Correction by a qualified professional is recommended.
- The decking under the equipment was found to be damaged or deteriorated at the time of inspection. Repairs or improvements may be necessary to ensure the equipment is properly supported.
- The water heater flue (vent pipe) does not have adequate clearance from combustible materials. Per current standards, double-walled vent pipes require a minimum 1 inch clearance, and single-walled vent pipes require a minimum 6 inches. Correction by a qualified professional is recommended to ensure safe operation.
- The temperature and pressure (TPR) relief valve discharge pipe runs upward in one or more locations. TPR discharge pipes should slope downward at all points to allow proper gravity drainage. Correction by a qualified professional is recommended.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



D. Hydro-Massage Therapy Equipment

Comments:

Location of GFCI: Within the hydro-therapy housing / cabinet area.

- Not all of the jets were operational at the time of inspection. This condition should be further evaluated and corrected as necessary.
- Black residue and/or discolored water was observed during operation of the hydro-massage tub. This condition should be further evaluated and corrected as necessary.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



E. Gas Distribution Systems and Gas Appliances

Location of gas meter: At the Neighborhood Meter Bank.

Type of gas distribution piping material: Black Steel Pipe, Flexible Appliance Connector

Comments:

- The electrical bonding connection for the gas piping to the grounding electrode system could not be located. All bonding connections should be accessible for inspection, repair, or replacement. This condition should be further investigated and corrected as necessary.

Notice: The Inspector will use a combustible gas leak detector on accessible gas lines, joints, unions and connectors and report visible deficiencies found at the time and date of the inspection. The inspector inspects the gas lines from the point they enter the structure and will complete the inspection without digging, damaging property, permanent construction or building finish. When performing the inspection, the inspector will keep in consideration the age of the system and normal wear and tear from ordinary use when rendering opinions.

The inspector is not required to and will not inspect sacrificial anode bonding or for its existence. The Inspector is not licensed to and will not perform a pressure test on the gas line system. The Inspector cannot detect gas leaks below the finished grade (underground), construction voids, between the walls or behind fireplace hearths. Propane tanks will not be inspected. If any further concerns exist about possible gas line failure and/or deficiencies or code compliance, we recommend the buyer have the gas system further evaluated by the local controlling gas supplier and/or a qualified licensed master plumber prior to

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
----------	-----------	-----------	----------

the expiration of any time limitations such as option or warranty periods.
--

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

V. APPLIANCES

A. Dishwashers

Comments:


All components were found to be performing and in satisfactory condition on the day of the inspection.



B. Food Waste Disposers

Comments:

- The food waste disposer was observed to be noisy during operation. This could indicate internal wear, loose components, or debris. Further evaluation and servicing or replacement is recommended to prevent potential failure.
- The spliced wires at the food waste disposer should be properly enclosed in a junction box or appropriate electrical enclosure. This is necessary for safety and to prevent electrical shock or short circuits.

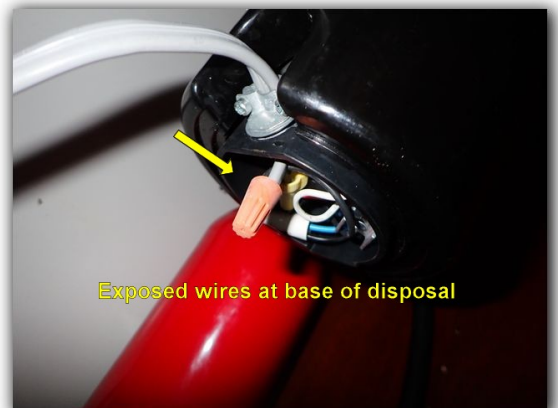

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

C. Range Hood and Exhaust Systems

Comments:

- The range exhaust vent fan was inoperative at the time of inspection. This condition should be further evaluated and corrected as necessary.

Note: The range hood installed is a ductless type and does not vent to the exterior. Its operation relies on an internal filter. It is recommended that the filter be cleaned or replaced regularly in accordance with the manufacturer's instructions to help maintain performance and reduce the potential for moisture, grease, and odor accumulation within the structure.



D. Ranges, Cooktops, and Ovens

Comments:

Range

All components were found to be performing and in satisfactory condition on the day of the inspection.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



E. Microwave Ovens

Comments:

- The microwave oven was inoperative at the time of inspection and did not respond to normal user controls. The unit should be further evaluated and repaired or replaced as needed to restore proper function.



F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

G. Garage Door Operators

Comments:

Note: This appliance was not present/not installed at the time of inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

H. Dryer Exhaust Systems

Comments:

- The dryer exhaust duct was separated from the wall mount at the time of inspection. Reset is needed prior to dryer use.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



VI. OPTIONAL SYSTEMS

-
-
-
-

A. Thermal Imaging / Infrared

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

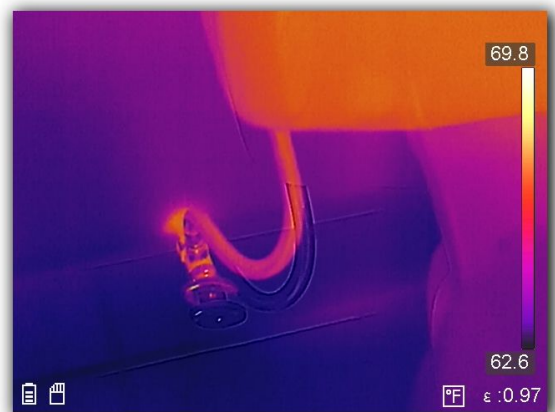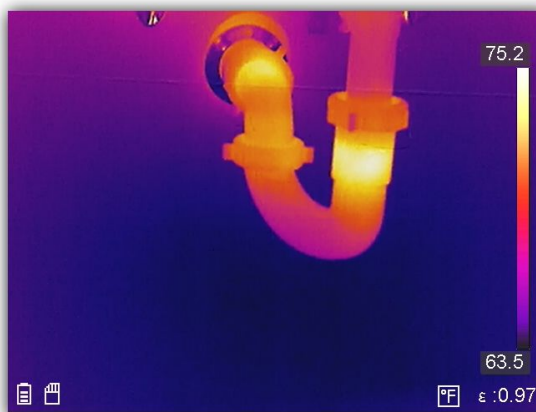


I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

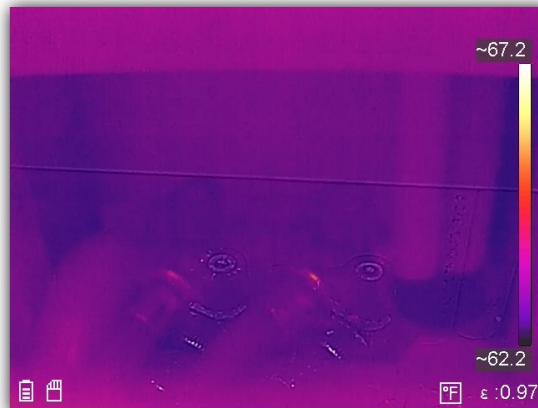

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



INSPECTION AGREEMENT
PLEASE READ THIS AGREEMENT CAREFULLY BEFORE SIGNING

This Inspection Agreement (herein after known as the Agreement) is entered into on this day, 03/18/2026, between Heather Baldwin (herein known as the Client) and A-Action Home Inspection Group (herein known as the Inspector) for the purpose of performing a general property condition inspection concerning 1620 Elgin St. Unit 9 (herein known as the property).

I. SCOPE OF SERVICES

- A. A real estate inspection is a non-technically exhaustive, limited visual survey and basic performance evaluation of the systems and components of a building using normal controls and does not require the use of specialized equipment or procedures. The purpose of the inspection is to provide the Client with information regarding the general condition of the Property at the time of inspection.
- B. In exchange for the inspection fee (\$531.00) paid by the Client, the Inspector agrees to provide the Client with an Inspection Report setting out the Inspector's professional opinions concerning the condition of the Property further described in the report. The inspection will be performed in accordance with the Standards of Practice promulgated by the Texas Real Estate Commission. Inspector will attempt to identify major defects and problems with the Property. However, Client acknowledges that the Inspection Report may not identify all defects or problems.
- C. The inspection is limited to those items which are easily accessible, seen, viewed or capable of being approached, entered and/or operated by the Inspector at the time of the inspection as set out in the Inspection Report. The Inspector will not climb over obstacles, move furnishings or large, heavy, or fragile objects, remove walls, floors, wall coverings, floor coverings and other obstructions in order to inspect concealed items. The inspector will not turn on decommissioned equipment, systems, utility services. Systems, components and conditions which are not specifically addressed in the Inspection Report are excluded.
- D. The Inspection Report may indicate one of the following opinions of the Inspector regarding a particular item:
 - 1. The item is performing its intended function, achieving an operation, function or configuration relative to accepted industry standard practices with consideration of age and normal wear and tear from ordinary use at the time of the inspection;
 - 2. The item is in need of replacement, maintenance or repair; or
 - 3. Further evaluation by an expert is recommended.

II. INSPECTION REPORT

- A. The Inspection Report provided by the Inspector will contain the Inspector's professional, good-faith opinions concerning the need for repair or replacement of certain observable items. All statements in the report are the Inspector's opinions and should not be construed as statements of fact or factual representations concerning the Property. **By signing this Agreement, the Client understands that the services provided by the Inspector fall within the Professional Services Exemption of the Texas Deceptive Trade Practices Act ("DTPA") and agrees that no cause of action exists under the DTPA related to the services provided.**
- B. **Unless specifically stated, the report WILL NOT INCLUDE and should not be read to indicate OPINIONS AS TO;**
 - 1. the presence, absence, or risk of environmental conditions such as asbestos, lead-based paint, **MOLD**, mildew, corrosive or contaminated drywall "Chinese Drywall" or any other environmental hazard, environmental pathogen, carcinogen, toxin, mycotoxin, pollutant, fungal presence or activity, poison, presence of toxic or hazardous waste or substances;
 - 2. presence or absence of pests, termites, or other wood-destroying insects or organisms;
 - 3. **COMPLIANCE WITH compliance with any ordinances, statutes or restrictions, CODE, listing, testing or protocol authority, utility sources, property association guidelines or requirements, manufacturer or regulatory requirements;**
 - 4. insurability, efficiency warrantability, suitability, adequacy, compatibility, capacity, durability, quality reliability, marketability, operating costs, recalls, counterfeit products, product lawsuits, age, energy efficiency; or
 - 5. anticipate future life or future events or changes in performance of any item inspected.
- C. The Inspection Report is not a substitute for disclosures by sellers and real estate agents. Said disclosure statements should be carefully investigated for any material facts that may influence or effect the desirability and/or market value of the Property.
- D. As noted above, the Inspection Report may state that further evaluation of certain items is needed by an expert in the field of the item inspected. By signing this Agreement, Client acknowledges that qualified experts may be needed to further evaluate such items as structural systems, foundations, grading, drainage, roofing, plumbing, electrical systems, HVAC, appliances, sprinkler systems pool system and components, fire/smoke detection systems, septic systems and other observable items as noted in the report. Any such follow-up should take place prior to the expiration of any time limitations such as option or warranty periods.

III. DISCLAIMER OF WARRANTIES

The inspector makes no guarantee or warranty, express or implied, as to any of the following:

1. That all defects have been found or that the Inspector will pay for repair of undisclosed defects;
2. That any of the items inspected are designed or constructed in a good and workmanlike manner;
3. That any of the items inspected will continue to perform in the future as they are performing at time of the inspection; and
4. That any of the items inspected are merchantable or fit for any particular purpose.

IV. LIMITATION OF LIABILITY

BY SIGNING THIS AGREEMENT, CLIENT ACKNOWLEDGES THAT THE INSPECTION FEE PAID TO THE INSPECTOR IS NOMINAL GIVEN THE RISK OF LIABILITY ASSOCIATED WITH PERFORMING HOME INSPECTIONS IF LIABILITY COULD NOT BE LIMITED. CLIENT ACKNOWLEDGES THAT WITHOUT THE ABILITY TO LIMIT LIABILITY, THE INSPECTOR WOULD BE FORCED TO CHARGE CLIENT MUCH MORE THAN THE INSPECTION FEE FOR THE INSPECTOR'S SERVICES. CLIENT ACKNOWLEDGES BEING GIVEN THE OPPORTUNITY TO HAVE THIS AGREEMENT REVIEWED BY COUNSEL OF HIS OR HER OWN CHOOSING AND FURTHER ACKNOWLEDGES THE OPPORTUNITY OF HIRING A DIFFERENT INSPECTOR TO PERFORM THE INSPECTION. BY SIGNING THIS AGREEMENT, CLIENT AGREES TO LIABILITY BEING LIMITED TO THE AMOUNT OF THE INSPECTION FEE PAID BY THE CLIENT. \$531.00

V. DISPUTE RESOLUTION

In the event a dispute arises regarding an inspection that has been performed under this agreement, the Client agrees to notify the Inspector within ten (10) days of the date the Client discovers the basis for the dispute so as to give the Inspector a reasonable opportunity to reinspect the property. Client agrees to allow reinspection before any corrective action is taken. Client agrees not to disturb or repair or have repaired anything which might constitute evidence relating to a complaint against the Inspector. Client further agrees that the Inspector can either conduct the reinspection himself or can employ others (at Inspector's expense) to reinspect the property, or both. In the event a dispute cannot be resolved by the Client and the Inspector, the parties agree that any dispute or controversy shall be resolved by mandatory and binding arbitration administered by the American Arbitration Association ("AAA") pursuant to Chapter 171 of the Texas Civil Practice & Remedies Code and in accordance with this arbitration agreement and the commercial arbitration rules of the AAA.

VI. ATTORNEY'S FEES

The Inspector and the Client agree that in the event any dispute or controversy arises as a result of this Agreement, and the services provided hereunder, the prevailing party in that dispute shall be entitled to recover all of the prevailing party's reasonable and necessary attorneys' fees and costs incurred by that party.

VII. EXCLUSIVITY

The Inspection Report is to be prepared exclusively for the Client and is not transferable to anyone in any form. Client gives permission for the Inspector to discuss report findings with real estate agents, specialists, or repair persons for the sake of clarification. A copy of the Inspection Report may be released to the buyers Real Estate Agent.

BY MY SIGNATURE BELOW, I ACKNOWLEDGE THAT I HAVE READ THIS CONTRACT AND THAT THE INSPECTOR DID NOT COERCE, PRESSURE OR RUSH ME TO EXECUTE THIS CONTRACT WITHOUT OPPORTUNITY TO FULLY REVIEW THE CONTRACT AND IF NECESSARY HAVE THE CONTRACT REVIEWED BY AN ATTORNEY; THAT INSPECTOR AGREED TO RESCHEDULE THE INSPECTION IN THE EVENT I REQUIRED ADDITIONAL TIME TO REVIEW THE CONTRACT; THAT I UNDERSTAND THE TERMS AND CONDITIONS AND THAT I AGREE TO BE BOUND BY THESE TERMS AND CONDITIONS. IF CLIENT IS MARRIED, CLIENT REPRESENTS THAT THIS OBLIGATION IS A FAMILY OBLIGATION INCURRED IN THE INTEREST OF THE FAMILY.

Client Signature: _____

Date: 03/18/2026

Inspector: Tyler Bauer

TEXAS OFFICIAL WOOD DESTROYING INSECT REPORT

Rule §7.176 Requires this department prescribed form to be used for real estate transactions in Texas regarding the visible presence or absence of wood destroying insects and conditions conducive to infestations of wood destroying insects.

1620 Elgin St. Unit 9

Inspected Address

Houston

City

77004

Zip Code

SCOPE OF INSPECTION

- A. This inspection covers only the multi-family structure, primary dwelling or place of business. Sheds, detached garages, lean-tos, fences, guest houses or any other structure will not be included in this inspection report unless specifically noted in Section 5 of this report.
- B. This inspection is limited to those parts of the structure(s) that are visible and accessible at the time of the inspection. Examples of inaccessible areas include but are not limited to (1) areas concealed by wall coverings, furniture, equipment and stored articles and (2) any portion of the structure in which inspection would necessitate removing or defacing any part of the structure(s) (including the surface appearance of the structure). **Inspection does not cover any condition or damage which was not visible in or on the structure(s) at time of inspection but which may be revealed in the course of repair or replacement work.**
- C. Due to the characteristics and behavior of various wood destroying insects, it may not always be possible to determine the presence of infestation without defacing or removing parts of the structure being inspected. Previous damage to trim, wall surface, etc., is frequently repaired prior to the inspection with putty, spackling, tape or other decorative devices. Damage that has been concealed or repaired may not be visible except by defacing the surface appearance. **The WDI inspecting company cannot guarantee or determine that work performed by a previous pest control company, as indicated by visual evidence of previous treatment, has rendered the pest(s) inactive.**
- D. If visible evidence of active or previous infestation of listed wood destroying insects is reported, it should be assumed that some degree of damage is present.
- E. If visible evidence is reported, it does not imply that damage should be repaired or replaced. Inspectors of the inspection company usually are not engineers or builders qualified to give an opinion regarding the degree of structural damage. Evaluation of damage and any corrective action should be performed by a qualified expert.
- F. **THIS IS NOT A STRUCTURAL DAMAGE REPORT OR A WARRANTY AS TO THE ABSENCE OF WOOD DESTROYING INSECTS.**
- G. If termite treatment (including pesticides, baits or other methods) has been recommended, the treating company must provide a diagram of the structure(s) inspected and proposed for treatment, label of pesticides to be used and complete details of warranty (if any). At a minimum, the warranty must specify which areas of the structure(s) are covered by warranty, renewal options and approval by a certified applicator in the termite category. Information regarding treatment and any warranties should be provided by the party contracting for such services to any prospective buyers of the property. The inspecting company has no duty to provide such information to any person other than the contracting party.
- H. There are a variety of termite control options offered by pest control companies. These options will vary in cost, efficacy, areas treated, warranties, treatment techniques and renewal options.
- I. There are some specific guidelines as to when it is appropriate for corrective treatment to be recommended. Corrective treatment may only be recommended if (1) there is visible evidence of an active infestation in or on the structure, (2) there is visible evidence of a previous infestation with no evidence of a prior treatment.
- J. If treatment is recommended based solely on the presence of conducive conditions, a preventive treatment or correction of conducive conditions may be recommended. The buyer and seller should be aware that there may be a variety of different strategies to correct the conducive condition(s). These corrective measures can vary greatly in cost and effectiveness and may or may not require the services of a licensed pest control operator. There may be instances where the inspector will recommend correction of the conducive conditions by either mechanical alteration or cultural changes. Mechanical alteration may be in some instances the most economical method to correct conducive conditions. If this inspection report recommends any type of treatment and you have any questions about this, you may contact the inspector involved, another licensed pest control operator for a second opinion, and/or the Structural Pest Control Service of the Texas Department of Agriculture.

1620 Elgin St. Unit 9 Houston 77004
Inspected Address City Zip Code

1A. SHARPEYE PEST CONTROL Name of Inspection Company
1B. 0773025 SPCS Business License Number

1C. 10718 Russett Drive Houston Texas 77042 713-730-3151
Address of Inspection Company City State Zip Telephone No.

1D. Tyler Bauer Name of Inspector (Please Print)
1E. Certified Applicator [] Technician [x] (check one)

1F. Wednesday, March 18, 2026
Inspection Date

2. Heather Baldwin Name of Person Purchasing Inspection
Seller [] Agent [] Buyer [x] Management Co. [] Other []

3. N/A
Owner/Seller

4. REPORT FORWARDED TO: Title Company or Mortgagee [] Purchaser of Service [] Seller [] Agent [x] Buyer [x]
(Under the Structural Pest Control regulations only the purchaser of the service is required to receive a copy)

The structure(s) listed below were inspected in accordance with the official inspection procedures adopted by the Texas Structural Pest Control Service. This report is made subject to the conditions listed under the Scope of Inspection. A diagram must be attached including all structures inspected.

5A. Main House Only. No Other Inspected Structures

List structure(s) inspected that may include residence, detached garages and other structures on the property. (Refer to Part A, Scope of Inspection)

5B. Type of Construction:
Foundation: Slab [x] Pier and Beam [] Pier Type: N/A Basement [] Other: N/A
Siding: Wood [x] Fiber Cement Board [x] Brick [x] Stone [] Stucco [] Other: N/A
Roof: Composition [x] Wood Shingle [] Metal [] Tile [] Other N/A

6A. This company has treated or is treating the structure for the following wood destroying insects: NO TREATMENT PERFORMED AT THIS TIME.

If treating for subterranean termites, the treatment was: Partial [] Spot [] Bait [] Other []
If treating for drywood termites or related insets, the treatment was: Full [] Limited []

6B. N/A N/A N/A
Date of Treatment by Inspecting Company Common Name of Insect Name of Pesticide, Bait or Other Method

This company has a contract or warranty in effect for control of the following wood destroying insects:
Yes [] No [x] List Insects: SHARPEYE PEST CONTROL CARRIES NO WARRANTY ON THIS PROPERTY.
If "Yes", copy(ies) of warranty and treatment diagram must be attached.

Neither I nor the company for which I am acting have had, presently have, or contemplate having any interest in the purchase of sale of this property. I do further state that neither I nor the company for which I am acting is associate in any way with any party to this real estate transaction.

Signatures:
7A. Tyler Bauer #0835996
Inspector (Technician or Certified Applicator Name and License Number)

Others Present:
7B. N/A
Apprentices, Technicians, or Certified Applicators (Names) and Registration/License Number(s)

Notice of Inspection Was Posted At or Near:
8A. Electric Breaker Box [] 8B. Date Posted: 03/18/2026
Water Heater Closet []
Beneath the Kitchen Sink [x]

9A. Were any areas of the property obstructed or inaccessible? Yes [x] No []
(Refer to Part B & C, Scope of Inspection) If "Yes" specify in 9B.

9B. The obstructed or inaccessible areas include but are not limited to the following:
Attic [] Insulated area of attic [x] Plumbing Areas [x] Planter box abutting structure []
Deck [] Sub Floors [x] Slab Joints [x] Craw Space []
Soil Grade Too High [] Heavy Foliage [] Eaves [x] Weepholes [x]
Other [x] Specify: Attic Partially Accessible, Construction Voids, Behind Floor/Wall Coverings, Behind Wall Coverings

10A. Conditions conducive to wood destroying insect infestation? Yes [x] No []
(Refer to Part J, Scope of Inspection) If "Yes" specify in 10B.

10B. Conducive Conditions include but are not limited to:
Wood to Ground Contact (G) [] Formboards left in place (I) [] Excessive Moisture (J) []
Debris under or around structure (K) [] Footing too low or soil line too high (L) [] Wood Rot (M) [] Heavy Foliage (N) []
Planter box abutting structure (O) [] Wood Pile in Contact with Structure (Q) [] Wooden Fence in Contact with the Structure (R) []
Insufficient ventilation (T) [] Other (C) [x] Specify: Wood in Concrete Expansion Joints, Plumbing Penetrations.

1620 Elgin St. Unit 9

Houston

77004

Inspected Address

City

Zip Code

11. Inspection Reveals Visible Evidence in or on the structure:

11A. Subterranean Termites

Active Infestation

Yes No

Previous Infestation

Yes No

Previous Treatment

Yes No

11B. Drywood Termites

Yes No

Yes No

Yes No

11C. Formosan Termites

Yes No

Yes No

Yes No

11D. Carpenter Ants

Yes No

Yes No

Yes No

11E. Other Wood Destroying Insects

Yes No

Yes No

Yes No

Specify: N/A

11F. Explanation of signs of previous treatment (including pesticides, baits, existing treatment stickers or other methods) identified:

N/A

11G. Visible evidence of: N/A has been observed in the following areas: N/A

If there is visible evidence of active or previous infestation, it must be noted. The type of insect(s) must be listed on the first blank and all identified infested areas of the property inspected must be noted in the second blank. (Refer to Part D, E & F, Scope of Inspection)

12A. Corrective treatment recommended for active infestation or evidence of previous infestation with no prior treatment as identified in Section 11. (Refer to Part G, H and I, Scope of Inspection)

Yes No

12B. A preventive treatment and/or correction of conducive conditions as identified in 10A & 10B is recommended as follows:

Yes


No

Specify reason: N/A

Refer to Scope of Inspection Part J

Diagram of Structure(s) Inspected

The inspector must draw a diagram including approximate perimeter measurements and indicate active or previous infestation and type of insect by using the following codes: E- Evidence of infestation; A-Active; P-Previous; D-Drywood Termites; S-Subterranean Termites; F-Formosan Termites; C-Conducive Conditions; B-Wood Boring Beetles; H-Carpenter Ants; Other(s) - Specify _____

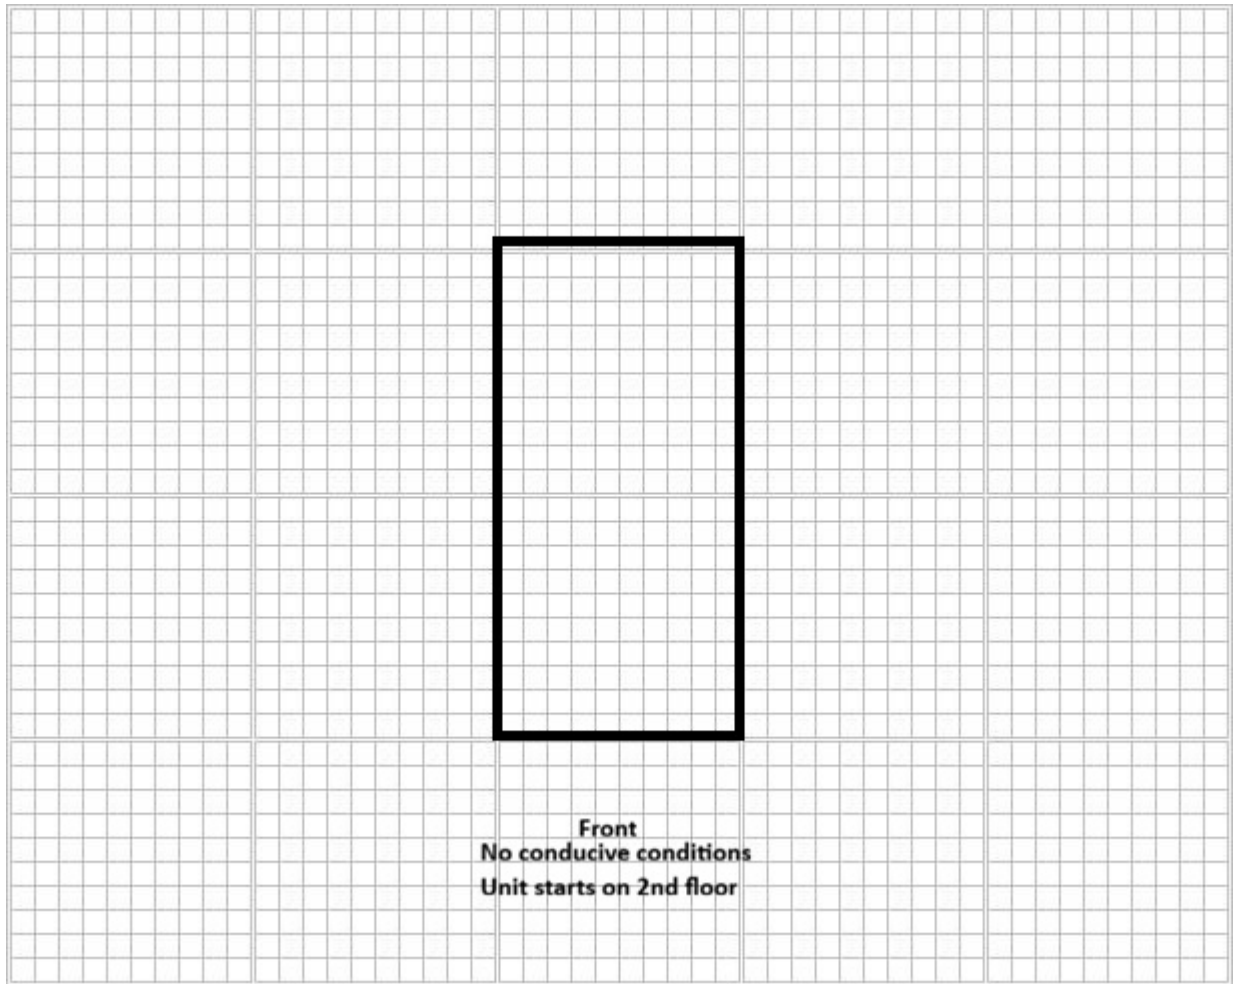

Additional Comments There is no visible evidence of active wood destroying insects found at the time of this inspection.

1620 Elgin St. Unit 9
Inspected Address

Houston
City

77004
Zip Code

Statement of Purchaser

I have received the original or a legible copy of this form. I have read and understand any recommendations made. I have also read and understand the "Scope of Inspection." I understand that my inspector may provide additional information as an addendum to this report.

If additional information is attached, list number of pages: Photo Page, Termite Inspection Agreement & Additional Statement Page, 4 pages

Signature of Purchaser of Property or their Designee

Date

Customer or Designee not Present **Buyers Initials** _____

1620 Elgin St. Unit 9

Houston


77004

Inspected Address

City

Zip Code

The digital pictures within this report are a representative sample of active/previous wood destroying insects, locations of active/previous infestations, inaccessible areas, conducive conditions, deficiencies or damages in place and should not be considered to show all. There will be active/previous wood destroying insects, locations of active/previous infestations, inaccessible areas, conducive conditions, deficiencies or damages not represented with digital imaging.

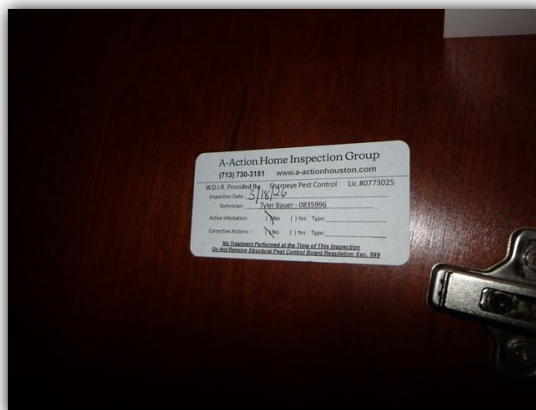

Sharpeye Pest Control Additional Statements Included in the Scope of Inspection / Agreement that are not Promulgated by the Structural Pest Control Service

- A. This inspection is only good for the date and time of the inspection. Sharpeye Pest Control, its Inspectors, employees and agents will not guarantee or warrant the absence of any wood destroying insect. Due to the characteristics and behavior of various wood destroying insects, the insects may not be visible or detectable on the date and time of the inspection. Even with the best inspection, termites can remain hidden and unnoticed for a long period of time. Swarming of wood destroying insects can occur in a short amount of time and may by the first signs of the presence of wood destroying insects that were not detectable at the time of the original inspection. If swarming occurs after the date and time of the original inspection and active wood destroying insects were not detectable at the time of the original inspection. Sharpeye Pest Control, its Inspectors, employees and agents cannot be liable for the non-detectable infestation and will not assume any liability for corrective actions needed and will not assume liability for non-detectable wood damage.
- B. Sharpeye Pest Control Standard Operational Inspection Procedures: The Inspector will perform a visual inspection of the visible and accessible foundation perimeter beam (slab-on-grade foundation), visual inspection of the visible and accessible exterior perimeter beam and accessible interior perimeter beam and piers (pier-&-beam foundation), probe visible and accessible exterior wood for active or signs of previous activity of a wood destroying insects, visual inspection of the structures accessible interior walls, ceiling, baseboards and cabinetry and visual inspection of the accessible areas of the attic.
The inspector will not deface the structure, cut holes, remove panels, pull back carpet, lift floor treatments, cut holes in the floors, wall or ceilings, move boxes, furniture, personal items or effects. The inspector will then complete this WDIR using the SPCS required standards for completing this form. These standards can be provided to you upon request.
- C. Additional Information from Sharpeye Pest Control. **AREAS OF POTENTIAL NON-VISIBLE WOOD DESTROYING INSECT ACTIVITY AREAS ARE LISTED BUT NOT LIMITED TO THE FOLLOWING:** In the wall voids at the bathroom bathtraps and shower stalls/enclosures, plumbing penetrations within the construction wall voids, below high soil lines, behind heavy foliage, non-visible slab joints, non-visible slab cracks, under and/or behind decks and/or raised patios, behind cosmetic repairs of the foundation beam, within sill plates and between sub-floors and any other area that the Inspector marks as inaccessible in section 6B of this report. Sharpeye Pest Control and its Inspectors, employees and agents will not assume any liability for active infestation of a wood destroying insect that is not visible and/or accessible to the Inspector at the time of the original inspection.
- D. The Inspector will do his/her best to access and to inspect all accessible and visible areas and/or components of the structure. This inspection is only good for the date and time of this inspection and Sharpeye Pest Control, its Inspectors, employees and agents will not assume any liability for non-accessible areas and non-visible wood destroying insects. If for any reason you are unhappy with the performance of the Inspector, his/her findings or unwilling to accept the scope of this inspection. Sharpeye Pest Control will be more than happy to refund to you the cost of this inspection within ten business day's from the date of the original inspection. The refund is contingent on you surrendering all copies of this inspection report back to Sharpeye Pest Control and you releasing Sharpeye Pest Control, its employee and its agents from all future liabilities to the inspected property. This refund cannot be made if the report has already been used to close on a real estate transaction.

WOOD-DESTROYING INSECT INSPECTION AGREEMENT

This is a Wood-Destroying Insect Inspection Agreement ("Agreement") between Sharpeye Pest Control ("INSPECTION COMPANY") and the undersigned client **Heather Baldwin** ("CLIENT"), collectively referred to herein as the "PARTIES." CLIENT agrees to employ the INSPECTION COMPANY to perform a wood-destroying insect inspection as set forth below.

1. **Property Address.** The address of the property to be inspected is: **1620 Elgin St. Unit 9 Houston, TX 77004** ("Property").
2. **Fee.** The fee for the inspection service has been included in the cost of the home inspection to be performed by A-Action Home Inspection Group, LLC. By signing this Agreement, Client acknowledges that A-Action Home Inspection Group, LLC and Sharpeye Pest Control are separate and distinct entities.
3. **Purpose.** The purpose of the inspection is to attempt to detect the presence of wood-destroying insects by performing a visual inspection of the Property without removing or defacing any part of the structure.
4. **Scope of Inspection.**
 - A. The inspection covers only the multi-family structure, primary dwelling or place of business. Sheds, detached garages, lean-tos, fences, guest houses or any other structure will not be included in this inspection.
 - B. The inspection is limited to those parts of the structure that are visible and accessible at the time of the inspection. Examples of inaccessible areas include, but are not limited to, the following: (1) areas concealed by wall coverings, furniture, equipment and stored articles and (2) any portion of the structure in which inspection would necessitate removing or defacing any part of the structure(s) (including the surface appearance of the structure). The inspection does not cover any condition or damage which was not visible in or on the structure(s) at time of inspection but which may be revealed in the course of repair or replacement work.
 - C. Client understands and agrees that due to the characteristics and behavior of various wood destroying insects, the inspection may not detect the presence of infestation because the Inspection Company is unable to deface or remove parts of the structure being inspected. Client understands that often, previous damage to trim, wall surface, etc., is frequently concealed with putty, spackling, or other decorative material. Therefore, wood-destroying insects are often not discoverable until sheetrock or other coverings are removed.
 - D. If visible evidence of active or previous infestation of wood destroying insects is reported, it should be assumed that some degree of damage is present.
 - E. If visible evidence is reported, it does not imply that damage should be repaired or replaced. Inspectors of the inspection company usually are not engineers or builders qualified to give an opinion regarding the degree of structural damage. Evaluation of damage and any corrective action should be performed by a qualified expert.
 - F. **THE INSPECTION IS NOT A STRUCTURAL DAMAGE INSPECTION OR A WARRANTY AS TO THE ABSENCE OF WOOD DESTROYING INSECTS.**
5. **Report.** The CLIENT will be provided with a written report of the INSPECTION COMPANY's visual observations and opinions. The Inspection Report provided by the Inspector will contain the Inspector's professional, good-faith opinions. All statements in the report are the Inspector's opinions and should not be construed as statements of fact or factual representations concerning the Property. By signing this Agreement, the Client understands that the services provided by the Inspector fall within the Professional Services Exemption of the Texas Deceptive Trade Practices Act ("DTPA") and agrees that no cause of action exists under the DTPA related to the services provided.
6. **Exclusivity.** The report is intended for the sole, confidential and exclusive use and benefit of the CLIENT and the INSPECTION COMPANY has no obligation or duty to any other party. INSPECTION COMPANY accepts no responsibility for use by third parties. There are no third party beneficiaries to this Agreement. This Agreement is not transferable or assignable.
7. **LIMITATION OF LIABILITY.**

IT IS UNDERSTOOD THE INSPECTION COMPANY IS NOT AN INSURER AND THAT THE INSPECTION AND REPORT SHALL NOT BE CONSTRUED AS A GUARANTEE OR WARRANTY OF ANY KIND. BY SIGNING THIS AGREEMENT, CLIENT ACKNOWLEDGES THAT THE INSPECTION FEE PAID TO THE INSPECTION COMPANY IS NOMINAL GIVEN THE RISK OF LIABILITY ASSOCIATED WITH PERFORMING WOOD-DESTROYING-INSECT INSPECTIONS IF LIABILITY COULD NOT BE LIMITED. CLIENT ACKNOWLEDGES THAT WITHOUT THE ABILITY TO LIMIT LIABILITY, THE INSPECTION COMPANY WOULD BE FORCED TO CHARGE CLIENT MUCH MORE THAN THE INSPECTION FEE FOR THE INSPECTOR'S SERVICES. CLIENT ACKNOWLEDGES BEING GIVEN THE OPPORTUNITY TO HAVE THIS AGREEMENT REVIEWED BY COUNSEL OF HIS OR HER OWN CHOOSING AND FURTHER ACKNOWLEDGES THE OPPORTUNITY OF HIRING A DIFFERENT INSPECTOR TO PERFORM THE INSPECTION. BY SIGNING THIS AGREEMENT, CLIENT AGREES TO LIABILITY BEING LIMITED TO THE AMOUNT OF THE INSPECTION FEE (\$531.00) PAID BY THE CLIENT OR \$500.00, WHICHEVER IS GREATER. THE CLIENT AGREES TO HOLD THE INSPECTION COMPANY AND ITS RESPECTIVE OFFICERS, AGENTS AND EMPLOYEES HARMLESS FROM AND AGAINST ANY AND ALL LIABILITIES, DEMANDS, CLAIMS, AND EXPENSES INCIDENT THERETO FOR INJURIES TO PERSONS AND FOR LOSS OF, DAMAGE TO, DESTRUCTION OF PROPERTY, COST OF REPAIRING OR REPLACING, OR CONSEQUENTIAL DAMAGE ARISING OUT OF OR IN CONNECTION WITH THIS INSPECTION.
--
8. **Disclaimer of Warranties.** The Inspector makes no guarantee, warranty or promise, express or implied, that all signs of past or present termite infestation have been found or that the Inspector will pay for treatment or cost of repairs.
9. **Dispute Resolution.** In the event a dispute arises regarding an inspection that has been performed under this agreement, the Client agrees to notify the Inspector within ten (10) days of the date the Client discovers the basis for the dispute so as to give the Inspector a reasonable opportunity to re-inspect the property. Client agrees to allow re-inspection before any corrective action is taken. Client agrees not to disturb or

repair or have repaired anything which might constitute evidence relating to a complaint against the Inspector. Client further agrees that the Inspector can either conduct the re-inspection himself or can employ others (at Inspector's expense) to re-inspect the property, or both. In the event a dispute cannot be resolved by the Client and the Inspector, the parties agree that any dispute or controversy shall be resolved by mandatory and binding arbitration administered by the American Arbitration Association ("AAA") pursuant to Chapter 171 of the Texas Civil Practice & Remedies Code and in accordance with this arbitration agreement and the commercial arbitration rules of the AAA.

10. **Attorney's Fees.** The INSPECTION COMPANY and CLIENT agree that in the event any dispute or controversy arises as a result of this Agreement, and the services provided hereunder, the prevailing party in that dispute shall be entitled to recover all of the prevailing party's reasonable and necessary attorneys' fees and costs incurred by that party.
11. **Entire Agreement.** This Agreement represents the entire agreement between the PARTIES. No statement or promise made by the INSPECTION COMPANY or its respective officers, agents or employees shall be binding.

BY MY SIGNATURE BELOW, I ACKNOWLEDGE THAT I HAVE READ THE FOREGOING CONTRACT; THAT I UNDERSTAND THE TERMS AND CONDITIONS AND THAT I AGREE TO BE BOUND BY THESE TERMS AND CONDITIONS. IF CLIENT IS MARRIED, CLIENT REPRESENTS THAT HE OR SHE HAS BEEN AUTHORIZED TO ENTER INTO THIS AGREEMENT ON BEHALF OF HIS OR HER SPOUSE AND/OR OTHER FAMILY MEMBER(S).

Client Signature: _____ Date: 03/18/2026

Inspector: Tyler Bauer Date: 03/18/2026