



SELLER'S DISCLOSURE NOTICE

©Texas Association of REALTORS®, Inc. 2023

Section 5.008, Property Code requires a seller of residential property of not more than one dwelling unit to deliver a Seller's Disclosure Notice to a buyer on or before the effective date of a contract. **This form complies with and contains additional disclosures which exceed the minimum disclosures required by the Code.**

CONCERNING THE PROPERTY AT 5123 Crystal Bay Drive, Houston, Texas 77084

THIS NOTICE IS A DISCLOSURE OF SELLER'S KNOWLEDGE OF THE CONDITION OF THE PROPERTY AS OF THE DATE SIGNED BY SELLER AND IS NOT A SUBSTITUTE FOR ANY INSPECTIONS OR WARRANTIES THE BUYER MAY WISH TO OBTAIN. IT IS NOT A WARRANTY OF ANY KIND BY SELLER, SELLER'S AGENTS, OR ANY OTHER AGENT.

Seller Is Is not occupying the property. If unoccupied (by Seller), how long since Seller has occupied The Property? A few days (approximate date) Never occupied the Property.

Section 1. The Property has the items marked below: (Mark Yes (Y), No (N), or Unknown (U).)

This notice does not establish the items to be conveyed. The contract will determine which items will & will not convey.

Item	Y	N	U	Item	Y	N	U	Item	Y	N	U
Cable TV Wiring			✓	Natural Gas Lines			✓	Pump: <input type="checkbox"/> sump <input type="checkbox"/> grinder			✓
Carbon Monoxide Det.		✓		Fuel Gas Piping:		✓		Rain Gutters	✓		
Ceiling Fans	✓			-Black Iron Pipe			✓	Range/Stove	✓		
Cooktop	✓			-Copper			✓	Roof/Attic Vents	✓		
Dishwasher	✓			-Corrugated Stainless Steel Tubing			✓	Sauna		✓	
Disposal	✓			Hot Tub		✓		Smoke Detector	✓		
Emergency Escape Ladder(s)		✓		Intercom System		✓		Smoke Detector – Hearing Impaired		✓	
Exhaust Fans	✓			Microwave	✓			Spa		✓	
Fences	✓			Outdoor Grill		✓		Trash Compactor		✓	
Fire Detection Equip.	✓			Patio/Decking	✓			TV Antenna		✓	
French Drain		✓		Plumbing System	✓			Washer/Dryer Hookup	✓		
Gas Fixtures		✓		Pool		✓		Window Screens	✓		
Liquid Propane Gas:		✓		Pool Equipment		✓		Public Sewer System	✓		
-LP Community (Captive)		✓		Pool Maint. Accessories		✓					
-LP on Property		✓		Pool Heater		✓					

Item	Y	N	U	Additional Information
Central A/C	✓			<input checked="" type="checkbox"/> electric <input type="checkbox"/> gas number of units: 1
Evaporative Coolers			✓	number of units:
Wall/Window AC Units		✓		number of units:
Attic Fan(s)			✓	if yes, describe:
Central Heat	✓			<input checked="" type="checkbox"/> electric <input checked="" type="checkbox"/> gas number of units: 1
Other Heat		✓		if yes describe:
Oven	✓			number of ovens: 1 <input checked="" type="checkbox"/> electric <input type="checkbox"/> gas <input type="checkbox"/> other:
Fireplace & Chimney	✓			<input checked="" type="checkbox"/> wood <input type="checkbox"/> gas logs <input type="checkbox"/> mock <input type="checkbox"/> other:
Carport		✓		<input type="checkbox"/> attached <input type="checkbox"/> not attached
Garage	✓			<input checked="" type="checkbox"/> attached <input type="checkbox"/> not attached
Garage Door Openers	✓			number of units: 1 number of remotes: 1
Satellite Dish & Controls		✓		<input type="checkbox"/> owned <input type="checkbox"/> leased from
Security System		✓		<input type="checkbox"/> owned <input type="checkbox"/> leased from



Solar Panels	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> owned <input type="checkbox"/> leased from
Water Heater	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/> electric <input checked="" type="checkbox"/> gas <input type="checkbox"/> other: number of units: 1
Water Softener	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/> owned <input type="checkbox"/> leased from
Other Leased Item(s)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	if yes, describe:
Underground Lawn Sprinkler	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/> automatic <input type="checkbox"/> manual areas covered:
Septic / On-Site Sewer Facility	<input type="checkbox"/>	<input checked="" type="checkbox"/>	if yes, attach Information About On-Site Sewer Facility (TXR-1407)

Water supply provided by: City Well MUD Co-op Unknown Other: _____

Was the Property built before 1978? yes no unknown

(If yes, complete, sign, and attach TXR-1906 concerning lead-based paint hazards).

Roof Type: Architectural Shingle Age: 0 (approximate)

Is there an overlay roof covering on the Property (shingles or roof covering placed over existing shingles or roof covering)? Yes No Unknown

Are you (Seller) aware of any of the items listed in this Section 1 that are not in working condition, that have defects, or are need of repair? yes no If yes, describe (attach additional sheets if necessary):

Section 2. Are you (Seller) aware of any defects or malfunctions in any of the following? (Mark Yes (Y) if you are aware and No (N) if you are not aware.)

Item	Y	N	Item	Y	N	Item	Y	N
Basement		<input checked="" type="checkbox"/>	Floors		<input checked="" type="checkbox"/>	Sidewalks		<input checked="" type="checkbox"/>
Ceilings		<input checked="" type="checkbox"/>	Foundation / Slab(s)		<input checked="" type="checkbox"/>	Walls / Fences		<input checked="" type="checkbox"/>
Doors		<input checked="" type="checkbox"/>	Interior Walls		<input checked="" type="checkbox"/>	Windows		<input checked="" type="checkbox"/>
Driveways		<input checked="" type="checkbox"/>	Lighting Fixtures		<input checked="" type="checkbox"/>	Other Structural Components		<input checked="" type="checkbox"/>
Electrical Systems		<input checked="" type="checkbox"/>	Plumbing Systems		<input checked="" type="checkbox"/>			
Exterior Walls		<input checked="" type="checkbox"/>	Roof		<input checked="" type="checkbox"/>			

If the answer to any of the items in Section 2 is yes, explain (attach additional sheets if necessary):

Section 3. Are you (Seller) aware of any of the following conditions? (Mark Yes (Y) if you are aware and No (N) if you are not aware.)

Condition	Y	N	Condition	Y	N
Aluminum Wiring		<input checked="" type="checkbox"/>	Radon Gas		<input checked="" type="checkbox"/>
Asbestos Components		<input checked="" type="checkbox"/>	Settling		<input checked="" type="checkbox"/>
Diseased Trees: oak wilt		<input checked="" type="checkbox"/>	Soil Movement		<input checked="" type="checkbox"/>
Endangered Species/Habitat on Property		<input checked="" type="checkbox"/>	Subsurface Structure or Pits		<input checked="" type="checkbox"/>
Fault Lines		<input checked="" type="checkbox"/>	Underground Storage Tanks		<input checked="" type="checkbox"/>
Hazardous or Toxic Waste		<input checked="" type="checkbox"/>	Unplatted Easements		<input checked="" type="checkbox"/>
Improper Drainage		<input checked="" type="checkbox"/>	Unrecorded Easements		<input checked="" type="checkbox"/>
Intermittent or Weather Springs		<input checked="" type="checkbox"/>	Urea-formaldehyde Insulation		<input checked="" type="checkbox"/>
Landfill		<input checked="" type="checkbox"/>	Water Damage Not Due to a Flood Event		<input checked="" type="checkbox"/>
Lead-Based Paint or Lead-Based Pt. Hazards		<input checked="" type="checkbox"/>	Wetlands on Property		<input checked="" type="checkbox"/>
Encroachments onto the Property		<input checked="" type="checkbox"/>	Wood Rot		<input checked="" type="checkbox"/>



Improvements encroaching on others' property		✓
Located in Historic District		✓
Historic Property Designation		✓
Previous Foundation Repairs		✓
Previous Roof Repairs	✓	
Previous Other Structural Repairs		✓
Previous Use of Premises for Manufacture of Methamphetamine		✓

Active infestation of termites or other wood destroying insects (WDI)		✓
Previous treatment for termites or WDI		✓
Previous termite or WDI damage repaired		✓
Previous Fires		✓
Termite or WDI damage needing repair		✓
Single Blockable Main Drain in Pool/Hot Tub/Spa*		✓

If the answer to any of the items in Section 3 is yes, explain (attach additional sheets if necessary):

(Previous Roof Repairs) New roof as old roof was aged

*A single blockable main drain may cause a suction entrapment hazard for an individual.

Section 4. Are you (Seller) aware of any item, equipment, or system in or on the Property that is in need of repair, which has not been previously disclosed in this notice? yes no If yes, explain (attach additional sheets if necessary):

Section 5. Are you (Seller) aware of any of the following conditions?* (Mark Yes (Y) if you are aware and check wholly or partly as applicable. Mark No (N) if you are not aware.)

Y N

- Present flood insurance coverage.
- Previous flooding due to a failure or breach of a reservoir or a controlled or emergency release of water from a reservoir.
- Previous flooding due to a natural flood event.
- Previous water penetration into a structure on the Property due to a natural flood.
- Located wholly partly in a 100-year floodplain (Special Flood Hazard Area-Zone A, V, A99, AE, AO, AH, VE, or AR).
- Located wholly partly in a 500-year floodplain (Moderate Flood Hazard Area-Zone X (shaded)).
- Located wholly partly in a floodway.
- Located wholly partly in a flood pool.
- Located wholly partly in a reservoir.

If the answer to any of the above is yes, explain (attach additional sheets as necessary):

****If Buyer is concerned about these matters, Buyer may consult Information About Flood Hazards (TXR 1414).***



For purposes of this notice:

"100-year floodplain" means any area of land that: (A) is identified on the flood insurance rate map as a special flood hazard area, which is designated as Zone A, V, A99, AE, AO, AH, VE, or AR on the map; (B) has a one percent annual chance of flooding, which is considered to be a high risk of flooding; and (C) may include a regulatory floodway, flood pool, or reservoir.

"500-year floodplain" means any area of land that: (A) is identified on the flood insurance rate map as a moderate flood hazard area, which is designated on the map as Zone X (shaded); and (B) has a two-tenths of one percent annual chance of flooding, which is considered to be a moderate risk of flooding.

"Flood pool" means the area adjacent to a reservoir that lies above the normal maximum operating level of the reservoir and that is subject to controlled inundation under the management of the United States Army Corps of Engineers.

"Flood insurance rate map" means the most recent flood hazard map published by the Federal Emergency Management Agency under the National Flood Insurance Act of 1968 (42 U.S.C. Section 4001 et seq.).

"Floodway" means an area that is identified on the flood insurance rate map as a regulatory floodway, which includes the channel of a river or other watercourse and the adjacent land areas that must be reserved for the discharge of a base flood, also referred to as a 100-year flood, without cumulatively increasing the water surface elevation more than a designated height.

"Reservoir" means a water impoundment project operated by the United States Army Corps of Engineers that is intended to retain water or delay the runoff of water in a designated surface area of land.

Section 6. Have you (Seller) ever filed a claim for flood damage to the Property with any insurance provider, including the National Flood Insurance Program (NFIP)? yes no If yes, explain (attach additional sheets as necessary):

*Homes in high risk flood zones with mortgages from federally regulated or insured lenders are required to have flood insurance. Even when not required, the Federal Emergency Management Agency (FEMA) encourages homeowners in high risk, moderate risk, and low risk flood zones to purchase flood insurance that covers the structure(s) and the personal property within the structure(s).

Section 7. Have you (Seller) ever received assistance from FEMA or the U.S. Small Business Administration (SBA) for flood damage to the Property? yes no If yes, explain (attach additional sheets as necessary):

Section 8. Are you (Seller) aware of any of the following? (Mark Yes (Y) if you are aware. Mark No (N) if you are not aware.)

Y N

Room additions, structural modifications, or other alterations or repairs made without necessary permits, with unresolved permits, or not in compliance with building codes in effect at the time

Homeowners' associations or maintenance fees or assessments. If yes, complete the following:

Name of association: Hunters Park Community Association

Manager's Name: Unknown Phone: 2814631216

Fees or assessments are: \$ 500 per Year mandatory voluntary

Any unpaid fees or assessment for the Property? Yes (\$) No

If the Property is in more than one association, provide information about the other associations below or attach information to this notice.

Any common area (facilities such as pools, tennis courts, walkways, or other) co-owned in undivided interest with others. If yes, complete the following:



Any optional user fees for common facilities charged? yes no If yes, describe

- Any notices of violations of deed restrictions or governmental ordinances affecting the condition or use of the Property.
- Any lawsuits or other legal proceedings directly or indirectly affecting the Property. (Includes, but is not limited to: divorce, foreclosure, heirship, bankruptcy, and taxes.)
- Any death on the Property except for those deaths caused by: natural causes, suicide, or accident unrelated to the condition of the Property.
- Any condition on the Property which materially affects the health or safety of an individual.
- Any repairs or treatments, other than routine maintenance, made to the Property to remediate environmental hazards such as asbestos, radon, lead-based paint, urea-formaldehyde, or mold.
If yes, attach any certificates or other documentation identifying the extent of the remediation (for example, certificate of mold remediation or other remediation).
- Any rainwater harvesting system located on the Property that is larger than 500 gallons and that uses a public water supply as an auxiliary water source.
- The Property is located in a propane gas system service area owned by a propane distribution system retailer.
- Any portion of the Property that is located in a groundwater conservation district or a subsidence district.

If the answer to any of the items in Section 8 is yes, explain (attach additional sheets if necessary):

(Q2) HOA

Section 9. Within the last 4 years, have you (Seller) received any written inspection reports from persons who regularly provide inspections and who are either licensed as inspectors or otherwise permitted by law to perform inspections? yes no If yes, attach copies and complete the following:

Inspection Date	Type	Name of Inspector	No. of Pages
06-26-2023	Property Inspection	Stacey Megginson	18

Note: A buyer should not rely on the above-cited reports as a reflection of the current condition of the Property. A buyer should obtain inspections from inspectors chosen by the buyer.

Section 10. Check any tax exemption(s) which you (Seller) currently claim for the Property:

- Homestead
- Senior Citizen
- Disabled
- Wildlife Management
- Agricultural
- Disabled Veteran
- Other: _____
- Unknown



Hail Insurance for Certain Properties (TXR 2518) and contact the Texas Department of Insurance or the Texas Windstorm Insurance Association.

- (4) This Property may be located near a military installation and may be affected by high noise or air installation compatible use zones or other operations. Information relating to high noise and compatible use zones is available in the most recent Air Installation Compatible Use Zone Study or Joint Land Use Study prepared for a military installation and may be accessed on the Internet website of the military installation and of the county and any municipality in which the military installation is located.
- (5) If you are basing your offers on square footage, measurements, or boundaries, you should have those items independently measured to verify any reported information.
- (6) The following providers currently provide service to the Property:

Electric: <u>Reliant</u>	Phone #: <u>(866) 222-7100</u>
Sewer: <u>Harris County Water and Sewer</u>	Phone #: <u>(281) 579-4500</u>
Water: <u>Harris County Water and Sewer</u>	Phone #: <u>(281) 579-4500</u>
Cable: _____	Phone #: _____
Trash: <u>GFL</u>	Phone #: <u>(281) 368-8397</u>
Natural Gas: _____	Phone #: _____
Phone Company: _____	Phone #: _____
Propane: _____	Phone #: _____
Internet: _____	Phone #: _____

This Seller's Disclosure Notice was completed by Seller as of the date signed. The brokers have relied on this notice as true and correct and have no reason to believe it to be false or inaccurate. YOU ARE ENCOURAGED TO HAVE AN INSPECTOR OF YOUR CHOICE INSPECT THE PROPERTY.

The undersigned Buyer acknowledges receipt of the foregoing notice.

Signature of Buyer Date
Printed Name: _____

Signature of Buyer Date
Printed Name: _____



PROPERTY INSPECTION REPORT



Stacey Megginson License #22905
Bayou City Home Inspections

5123 Crystal Bay Drive
Inspection Prepared For: Caleb Karshner
Agent: Caleb Karshner -

Date of Inspection: 6/26/2023
Year Built: 1975 Size: 1795sqft
Weather: Sunny

PROPERTY INSPECTION REPORT

Prepared For: Caleb Karshner
 (Name of Client)

Concerning: 5123 Crystal Bay Drive , Houston Texas, 77084
 (Address or Other Identification of Inspected Property)

By: Stacey Megginson, License #22905 6/26/2023
 (Name and License Number of Inspector) (Date)

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at www.trec.texas.gov.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standards for inspections by TREC licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods.

Promulgated by the Texas Real Estate Commission (TREC) P.O. Box 12188, Austin, TX 78711-2188 (512) 936-3000
<http://www.trec.texas.gov>.

Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions.

Examples of such hazards include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathrooms, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms require a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

I. STRUCTURAL SYSTEMS

X				A. Foundations
---	--	--	--	----------------

Type of Foundation(s):

- The foundation was slab-on-grade. The slab is poured thicker at the edges, to form an integral footing; reinforcing rods strengthen the thickened edge.

X			X	B. Grading and Drainage
---	--	--	---	-------------------------

Comments:

- The home had a concrete driveway.

- Common cracks (1/4-inch or less) were visible in the driveway. Cracks exceeding 1/4-inch should be filled with an appropriate material to avoid continued damage to the driveway surface from freezing moisture.
- One or more downspouts discharged roof drainage next to the foundation. This condition can effect the ability of the soil to support the weight of the structure above and can cause damage related to soil/foundation movement. The Inspector recommends the installation of downspout extensions to discharge roof drainage a minimum of 6 feet from the foundation.



Common cracks (1/4-inch or less) were visible in the driveway. Cracks exceeding 1/4-inch should be filled with an appropriate material to avoid continued damage.



One or more downspouts discharged roof drainage next to the foundation. This condition can effect the ability of the soil to support the weight of the structure above and can cause damage related to soil/foundation movement. The Inspector recommends the installation of downspout extensions to discharge roof drainage a minimum of 6 feet from the foundation.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

X				C. Roof Covering Materials
---	--	--	--	-----------------------------------

Type(s) of Roof Covering: The roof was covered with 3-tab fiberglass asphalt shingles. These shingles are composed of a fiberglass mat embedded in asphalt and covered with ceramic-coated mineral granules.

Viewed From:

- The Inspector inspected the roof and its components by walking the roof.

Comments:

- The Inspector observed no deficiencies in the condition of the shingles, flashing and vents.

X			X	D. Roof Structure and Attics
---	--	--	---	-------------------------------------

Approximate Average Depth of Insulation:

- Attic floor insulation depth averages 3 to 4 inches.

Comments:

- The attic access hatch cover was not insulated. The Inspector recommends insulating the attic access hatch cover to reduce unwanted heat loss/gain.



The attic access hatch cover was not insulated.

The Inspector recommends insulating the attic access hatch cover to reduce unwanted heat loss/gain.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

X			X	E. Walls (Interior and Exterior)
---	--	--	---	---

Wall Materials:

- Exterior walls are made of brick
- Exterior walls are made of wood
- Interior walls are made of drywall

Comments:

- Wood siding covering the exterior walls of the home was old and exhibited weathering commensurate with the age of the home. It appeared to be adequately protecting the home at the time of the inspection.
- Wood siding covering exterior walls of the home had areas of advanced deterioration that will allow moisture intrusion of the wall assembly. The Inspector recommends replacement of siding in any such areas to help prevent damage from moisture intrusion to the home materials and the exterior wall structure. All work should be performed by a qualified contractor.
- Brick exterior walls had repaired stepped cracking visible in mortar joints. This condition is a structural concern and can have a variety of causes, often connected with soil movement. However, the Inspector did not observe any cracks in the foundation. Inspector recommend monitoring the crack if it widens.
- Cracking visible at the corners of doors and windows at walls in the main floor family room corresponded with areas having negative exterior grade. The Inspector recommends correcting grade around the home to ensure that roof and surface drainage is routed away from the foundation.
- Stains on the walls in the hallway bathroom visible at the time of the inspection appeared to be the result of moisture intrusion. The moisture meter showed no elevated moisture levels in the affected areas at the time of the inspection. Although this condition indicated that the source of moisture may have been corrected, further examination by a qualified contractor would be required to provide confirmation.


I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient


I	NI	NP	D
---	----	----	---

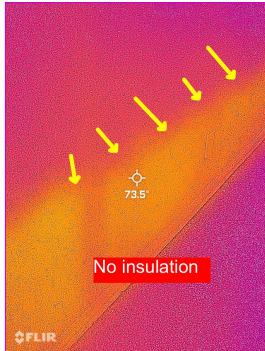


Stains on the walls in the hallway bathroom visible at the time of the inspection appeared to be the result of moisture intrusion. The moisture meter showed no elevated moisture levels in the affected areas at the time of the inspection. Although this condition indicated that the source of moisture may have been corrected, further examination by a qualified contractor would be required to provide confirmation.




Wood siding covering exterior walls of the home had areas of advanced deterioration that will allow moisture intrusion of the wall assembly. The Inspector recommends replacement of siding in any such areas to help prevent damage from moisture intrusion to the home materials and the exterior wall structure. All work should be performed by a qualified contractor.

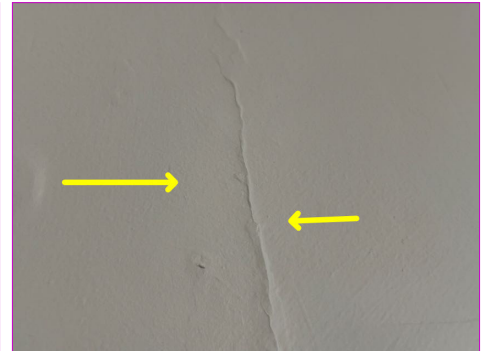


Cracking visible at the corners of doors and windows at walls in the main floor family room corresponded with areas having negative exterior grade. The Inspector recommends correcting grade around the home to ensure that roof and surface drainage is routed away from the foundation.

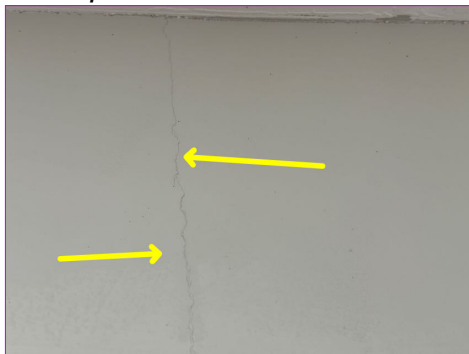

Cracking visible at the corners of doors and windows at walls in the main floor family room corresponded with areas having negative exterior grade. The Inspector recommends correcting grade around the home to ensure that roof and surface drainage is routed away from the foundation.

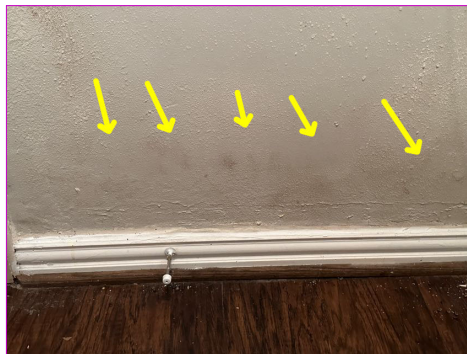

Stains on the walls in the hallway bathroom visible at the time of the inspection appeared to be the result of moisture intrusion. The moisture meter showed no elevated moisture levels in the affected areas at the time of the inspection. Although this condition indicated that the source of moisture may have been corrected, further examination by a qualified contractor would be required to provide confirmation.

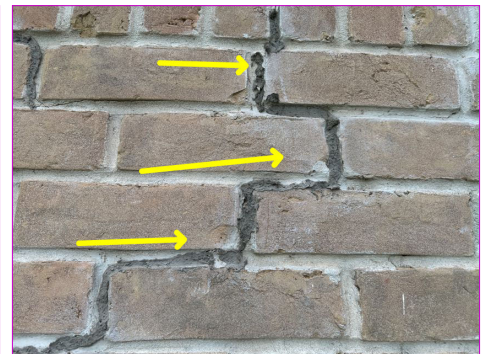

Brick exterior walls had repaired stepped cracking visible in mortar joints. This condition is a structural concern and can have a variety of causes, often connected with soil movement. However, the Inspector did not observe any cracks in the foundation. Inspector recommend monitoring the crack if it widens.


I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

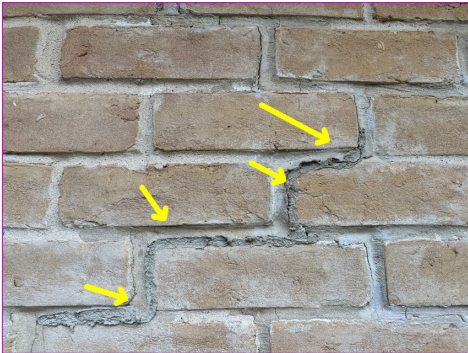

Brick exterior walls had repaired stepped cracking visible in mortar joints. This condition is a structural concern and can have a variety of causes, often connected with soil movement. However, the Inspector did not observe any cracks in the foundation. Inspector recommend monitoring the crack if it widens.

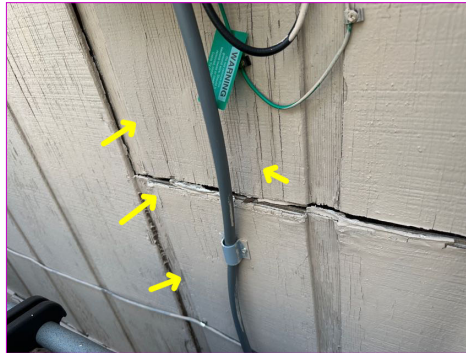

Wood siding covering the exterior walls of the home was old and exhibited weathering commensurate with the age of the home. It appeared to be adequately protecting the home at the time of the inspection.



Wood siding covering the exterior walls of the home was old and exhibited weathering commensurate with the age of the home. It appeared to be adequately protecting the home at the time of the inspection.

X				F. Ceilings and Floors
---	--	--	--	-------------------------------

Comments:

- At the time of the inspection, the Inspector observed no deficiencies in the condition of ceilings in the home.
- At the time of the inspection, the Inspector observed no deficiencies in the condition of floors in the home.

X				G. Doors (Interior and Exterior)
---	--	--	--	---

Comments:

- At the time of the inspection, the Inspector observed no deficiencies in the condition of door exteriors.
- Inspection of door exteriors typically includes examination of the following:
 - Door exterior surface condition
 - Weather-stripping condition
 - Presence of an effective sweep (sweeps are gaskets which seal the area between the bottom of a door and the threshold).
 - Jamb condition
 - Threshold condition
 - Moisture-intrusion integrity

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

X				H. Windows
---	--	--	--	------------

Window Types:

- Single-Hung Windows
- Single pane windows are made with a single layer of glass. They come in all of the same styles and materials that double-pane windows do, but they are not as efficient at keeping out noise or seasonal temperatures. Their initial cost is less, which makes them a good choice for those who need to stay within a strict budget, but over time, energy bills will be higher.

Single-pane glass treatments have no insulation. When you have only one pane of glass, outside temperatures and noise will affect the inside of your home more easily. If you live in a quiet neighborhood and your seasonal temperatures remain mild and consistent throughout the year, single-pane windows might be enough. However, the costs of heating or cooling down your home are directly related to the type of window you choose.

Comments:

- One or more windows have missing or damaged window screens. Recommend replacing or installing new ones.



One or more windows have missing or damaged window screens. Recommend replacing or installing new ones.

		X		I. Stairways (Interior and Exterior)
--	--	---	--	--------------------------------------

		X		J. Fireplaces and Chimneys
--	--	---	--	----------------------------

		X		K. Porches, Balconies, Decks, and Carports
--	--	---	--	--

	X			L. Fence Material
--	---	--	--	-------------------

	X			M. Observations
--	---	--	--	-----------------

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I	NI	NP	D
---	----	----	---

II. ELECTRICAL SYSTEMS

X				A. Service Entrance and Panels
---	--	--	--	--------------------------------

Materials and Amp Rating:
 • 125 Amp service panel

Comments:

• At the time of the inspection, the Inspector observed no deficiencies in the condition of the service panel.

Inspection of the main service panel typically includes examination of the following:

- Panel interior and exterior condition
- Panel amperage rating
- Main disconnect amperage rating and condition
- Main conductor amperage ratings
- Branch conductor types, amperage rating and condition
- Wiring visible materials, types, condition and connections
- Circuit breaker types, amperage ratings and condition
- Label information present
- Service and equipment grounding
- Bonding of service equipment

X			X	B. Branch Circuits, Connected Devices, and Fixtures
---	--	--	---	---

Comments:

• Some electrical receptacles in the media room were inoperable at the time of the inspection. The Inspector recommends service by a qualified electrical contractor.



Some electrical receptacles in the media room were inoperable at the time of the inspection. The Inspector recommends service by a qualified electrical contractor.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I	NI	NP	D
---	----	----	---

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

X				A. Heating Equipment
---	--	--	--	----------------------

Type of Systems:

- This furnace was mid-efficiency, forced-air.

Comments:

- This furnace responded adequately to the call for heat.

X				B. Cooling Equipment
---	--	--	--	----------------------

Observations:

- At the time of the inspection, the Inspector observed no deficiencies in the condition of the air-conditioning system.

- The differences in air temperature measured at supply and return registers fell within the acceptable range of between 14 and 22 degrees F.

X				C. Duct Systems, Chases, and Vents
---	--	--	--	------------------------------------

Comments:

- At the time of the inspection, the Inspector observed no deficiencies in the condition of the visible HVAC ducts.

I=Inspected NI=Not Inspected NP=Not Present D=Deficient

I	NI	NP	D
---	----	----	---

IV. PLUMBING SYSTEM

X			X	A. Plumbing Supply, Distribution System and Fixtures
---	--	--	---	--

Comments:

• Some water supply pipes in the home were half-inch galvanized steel. This pipes are old, and of a material no longer installed for this purpose due to bore shrinkage from accumulation of interior corrosion that over time reduces water flow. These pipes may need to be replaced soon. The Inspector recommends that before the expiration of your Inspection Objection Deadline you consult with a qualified contractor to discuss the necessity, options and costs for replacement.



Some water supply pipes in the home were half-inch galvanized steel. This pipes are old, and of a material no longer installed for this purpose due to bore shrinkage from accumulation of interior corrosion that over time reduces water flow. These pipes may need to be replaced soon. The Inspector recommends that before the expiration of your Inspection Objection Deadline you consult with a qualified contractor to discuss the necessity, options and costs for replacement.

Some water supply pipes in the home were half-inch galvanized steel. This pipes are old, and of a material no longer installed for this purpose due to bore shrinkage from accumulation of interior corrosion that over time reduces water flow. These pipes may need to be replaced soon. The Inspector recommends that before the expiration of your Inspection Objection Deadline you consult with a qualified contractor to discuss the necessity, options and costs for replacement.

X				B. Drains, Wastes, and Vents
---	--	--	--	------------------------------

Comments:

• All plumbing fixtures in the home exhibited functional drainage at the time of the inspection.

X				C. Water Heating Equipment
---	--	--	--	----------------------------

Capacity:
• Unit is 40 gallons

Comments:

• At the time of the inspection, the Inspector observed no deficiencies in the condition or operation of the water heater.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	D. Hydro-Massage Therapy Equipment
--------------------------	--------------------------	-------------------------------------	--------------------------	------------------------------------

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	E. Other
--------------------------	--------------------------	-------------------------------------	--------------------------	----------

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D

V. APPLIANCES

X			
---	--	--	--

A. Dishwashers
Comments:

- At the time of the inspection, the Inspector observed no deficiencies in the condition and operation of the dishwasher. It was operated through a cycle.

X			
---	--	--	--

B. Food Waste Disposers
Comments:

- At the time of the inspection, the Inspector observed no deficiencies in the condition and operation of the garbage disposal.

X			
---	--	--	--

C. Range Hood and Exhaust Systems
Comments:

- The range hood did not exhaust to the outside but re-circulated air through cleanable filters.
- At the time of the inspection, the Inspector observed no deficiencies in the condition and operation of the range hood exhaust fan and lights.

X			
---	--	--	--

D. Ranges, Cooktops, and Ovens
Comments:

- The Inspector observed no deficiencies during inspection of the range.

X			
---	--	--	--

E. Microwave Ovens
Comments:

- At the time of the inspection, the Inspector observed no deficiencies in the condition and operation of the built-in microwave oven. Built-in microwave ovens are tested using normal operating controls. Unit was tested and appeared to be serviceable at time of inspection. Leak and/or efficiency testing is beyond the scope of this inspection. If concerned, you should seek further evaluation by qualified technician prior to closing.

X			
---	--	--	--

F. Mechanical Exhaust Vents and Bathroom Heaters
Comments:

- All bathrooms and laundry had an operating exhaust ventilation at the time of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

X				G. Garage Door Operators
---	--	--	--	---------------------------------

Door Type:

- One - single 16', uninsulated steel panel, sectional roll-up doors.

Comments:

- The home had a two-car attached garage.
- At the time of the inspection, the Inspector observed no deficiencies in the condition of the garage.

X				H. Dryer Exhaust Systems
---	--	--	--	---------------------------------

Comments:

- At the time of the inspection, the Inspector observed no deficiencies in the condition of the dryer vent. The Inspector recommends that you have the dryer vent cleaned at the time of purchase and annually in the future to help ensure that safe conditions exist. Lint accumulation can occur even in approved, properly installed vents. All work should be performed by a qualified contractor.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

VI. OPTIONAL SYSTEMS

Report Summary

The summary below consists of potentially significant findings. These findings can be a safety hazard, a deficiency requiring a major expense to correct or items I would like to draw extra attention to. The summary is not a complete listing of all the findings in the report, and reflects the opinion of the inspector. Please review all pages of the report as the summary alone does not explain all of the issues. All repairs should be done by a licensed & bonded tradesman or qualified professional. I recommend obtaining a copy of all receipts, warranties and permits for the work done.

STRUCTURAL SYSTEMS

Page 3 Item: B	Grading and Drainage	<ul style="list-style-type: none"> • Common cracks (1/4-inch or less) were visible in the driveway. Cracks exceeding 1/4-inch should be filled with an appropriate material to avoid continued damage to the driveway surface from freezing moisture. • One or more downspouts discharged roof drainage next to the foundation. This condition can effect the ability of the soil to support the weight of the structure above and can cause damage related to soil/foundation movement. The Inspector recommends the installation of downspout extensions to discharge roof drainage a minimum of 6 feet from the foundation.
Page 4 Item: D	Roof Structure and Attics	<ul style="list-style-type: none"> • The attic access hatch cover was not insulated. The Inspector recommends insulating the attic access hatch cover to reduce unwanted heat loss/gain.
Page 5 Item: E	Walls (Interior and Exterior)	<ul style="list-style-type: none"> • Wood siding covering the exterior walls of the home was old and exhibited weathering commensurate with the age of the home. It appeared to be adequately protecting the home at the time of the inspection. • Wood siding covering exterior walls of the home had areas of advanced deterioration that will allow moisture intrusion of the wall assembly. The Inspector recommends replacement of siding in any such areas to help prevent damage from moisture intrusion to the home materials and the exterior wall structure. All work should be performed by a qualified contractor. • Brick exterior walls had repaired stepped cracking visible in mortar joints. This condition is a structural concern and can have a variety of causes, often connected with soil movement. However, the Inspector did not observe any cracks in the foundation. Inspector recommend monitoring the crack if it widens. • Cracking visible at the corners of doors and windows at walls in the main floor family room corresponded with areas having negative exterior grade. The Inspector recommends correcting grade around the home to ensure that roof and surface drainage is routed away from the foundation. • Stains on the walls in the hallway bathroom visible at the time of the inspection appeared to be the result of moisture intrusion. The moisture meter showed no elevated moisture levels in the affected areas at the time of the inspection. Although this condition indicated that the source of moisture may have been corrected, further examination by a qualified contractor would be required to provide confirmation.

Page 8 Item: H	Windows	<ul style="list-style-type: none"> • One or more windows have missing or damaged window screens. Recommend replacing or installing new ones.
ELECTRICAL SYSTEMS		
Page 9 Item: B	Branch Circuits, Connected Devices, and Fixtures	<ul style="list-style-type: none"> • Some electrical receptacles in the media room were inoperable at the time of the inspection. The Inspector recommends service by a qualified electrical contractor.
PLUMBING SYSTEM		
Page 11 Item: A	Plumbing Supply, Distribution System and Fixtures	<ul style="list-style-type: none"> • Some water supply pipes in the home were half-inch galvanized steel. This pipes are old, and of a material no longer installed for this purpose due to bore shrinkage from accumulation of interior corrosion that over time reduces water flow. These pipes may need to be replaced soon. The Inspector recommends that before the expiration of your Inspection Objection Deadline you consult with a qualified contractor to discuss the necessity, options and costs for replacement.

NOTICE TO PURCHASER OF SPECIAL TAXING OR ASSESSMENT DISTRICT

The real property that you are about to purchase is located in the Harris County Utility District No. 6 (the "District") and may be subject to District taxes or assessments. The District may, subject to voter approval, impose taxes and issue bonds. The District may impose an unlimited rate of tax in payment of such bonds. The current rate of the District property tax is \$0.288 on each \$100 of assessed valuation.

The total amounts of bonds payable wholly or partly from excluding any bonds or any portions of bonds issued that are payable solely from revenues received or expected to be received under a contract with a governmental entity, approved by the voters are:

\$26,275,000 for water, sanitary sewer, drainage, and storm sewer facilities and flood control facilities;

\$12,755,000 for drainage and storm sewer facilities;

\$ 4,920,000 for refunding bonds; and

\$ 465,000 for fire plan bonds.

The aggregate initial principal amounts of all such bonds issued are:

\$22,531,379 for water, sanitary sewer, drainage, storm sewer, and flood control facilities;

\$ 5,695,000 for drainage and storm sewer facilities; and

\$ 393,621 for fire plan bonds.

The District is located wholly or partly in the extraterritorial jurisdiction of the City of Houston. Texas law governs the ability of a municipality to annex property in the municipality's extraterritorial jurisdiction and whether a District that is annexed by the municipality is dissolved.

The District has entered into a strategic partnership agreement with the City of Houston. This agreement may address the timeframe, process, and procedures for the municipal annexation of the area of the District located in the municipality's extraterritorial jurisdiction.


RP-2025-423302

The purpose of the District is to provide water, sewer, drainage, and fire-fighting facilities and services. The cost of District facilities is not included in the purchase price of your property.


March 15, 2026

(Date)

Signed by:
SELLER:


Signature of Seller

Signed by:



7D3A20C05C404C9...

PURCHASER IS ADVISED THAT THE INFORMATION SHOWN ON THIS FORM IS SUBJECT TO CHANGE BY THE DISTRICT AT ANY TIME. THE DISTRICT ANNUALLY ESTABLISHES TAX RATES. PURCHASER IS ADVISED TO CONTACT THE DISTRICT TO DETERMINE THE STATUS OF ANY CURRENT OR PROPOSED CHANGES TO THE INFORMATION SHOWN ON THIS FORM.

The undersigned purchaser hereby acknowledges receipt of the foregoing notice at or before the execution of a binding contract for the purchase of real property or at closing of purchase of the real property.

PURCHASER:

(Date)

Signature of Purchaser

(APPROPRIATE ACKNOWLEDGEMENTS)

AFTER RECORDING, return to: _____.

RP-2025-423302



APPROVED BY THE TEXAS REAL ESTATE COMMISSION
**ADDENDUM FOR SELLER'S DISCLOSURE OF INFORMATION
ON LEAD-BASED PAINT AND LEAD-BASED PAINT HAZARDS
AS REQUIRED BY FEDERAL LAW**

10-10-11

CONCERNING THE PROPERTY AT 5123 Crystal Bay Drive Houston
(Street Address and City)

A. LEAD WARNING STATEMENT: "Every purchaser of any interest in residential real property on which a residential dwelling was built prior to 1978 is notified that such property may present exposure to lead from lead-based paint that may place young children at risk of developing lead poisoning. Lead poisoning in young children may produce permanent neurological damage, including learning disabilities, reduced intelligence quotient, behavioral problems, and impaired memory. Lead poisoning also poses a particular risk to pregnant women. The seller of any interest in residential real property is required to provide the buyer with any information on lead-based paint hazards from risk assessments or inspections in the seller's possession and notify the buyer of any known lead-based paint hazards. A risk assessment or inspection for possible lead-paint hazards is recommended prior to purchase."

NOTICE: Inspector must be properly certified as required by federal law.

B. SELLER'S DISCLOSURE:

- 1. PRESENCE OF LEAD-BASED PAINT AND/OR LEAD-BASED PAINT HAZARDS (check one box only):
 - (a) Known lead-based paint and/or lead-based paint hazards are present in the Property (explain): N/A
 - (b) Seller has no actual knowledge of lead-based paint and/or lead-based paint hazards in the Property.
- 2. RECORDS AND REPORTS AVAILABLE TO SELLER (check one box only):
 - (a) Seller has provided the purchaser with all available records and reports pertaining to lead-based paint and/or lead-based paint hazards in the Property (list documents): N/A
 - (b) Seller has no reports or records pertaining to lead-based paint and/or lead-based paint hazards in the Property.

C. BUYER'S RIGHTS (check one box only):

- 1. Buyer waives the opportunity to conduct a risk assessment or inspection of the Property for the presence of lead-based paint or lead-based paint hazards.
- 2. Within ten days after the effective date of this contract, Buyer may have the Property inspected by inspectors selected by Buyer. If lead-based paint or lead-based paint hazards are present, Buyer may terminate this contract by giving Seller written notice within 14 days after the effective date of this contract, and the earnest money will be refunded to Buyer.

D. BUYER'S ACKNOWLEDGMENT (check applicable boxes):

- 1. Buyer has received copies of all information listed above.
- 2. Buyer has received the pamphlet *Protect Your Family from Lead in Your Home*.

E. BROKERS' ACKNOWLEDGMENT: Brokers have informed Seller of Seller's obligations under 42 U.S.C. 4852d to:

(a) provide Buyer with the federally approved pamphlet on lead poisoning prevention; (b) complete this addendum; (c) disclose any known lead-based paint and/or lead-based paint hazards in the Property; (d) deliver all records and reports to Buyer pertaining to lead-based paint and/or lead-based paint hazards in the Property; (e) provide Buyer a period of up to 10 days to have the Property inspected; and (f) retain a completed copy of this addendum for at least 3 years following the sale. Brokers are aware of their responsibility to ensure compliance.

F. CERTIFICATION OF ACCURACY: The following persons have reviewed the information above and certify, to the best of their knowledge, that the information they have provided is true and accurate.

Buyer	Date	Signed by: Seller C98A5249449...	<u>03/06/2026</u> Date
Buyer	Date	Signed by: Seller A20C05C404C9...	<u>03/06/2026</u> Date
Other Broker	Date	Documented by: Listing Broker Timothy R. Adams	<u>03/06/2026</u> Date

The form of this addendum has been approved by the Texas Real Estate Commission for use only with similarly approved or promulgated forms of contracts. Such approval relates to this contract form only. TREC forms are intended for use only by trained real estate licensees. No representation is made as to the legal validity or adequacy of any provision in any specific transactions. It is not suitable for complex transactions. Texas Real Estate Commission, P.O. Box 12188, Austin, TX 78711-2188, 512-936-3000 (<http://www.trec.texas.gov>)

(TXR 1906) 10-10-11

TREC No. OP-L



PROMULGATED BY THE TEXAS REAL ESTATE COMMISSION (TREC)

11-07-2022

ADDENDUM FOR PROPERTY SUBJECT TO MANDATORY MEMBERSHIP IN A PROPERTY OWNERS ASSOCIATION



(NOT FOR USE WITH CONDOMINIUMS)

ADDENDUM TO CONTRACT CONCERNING THE PROPERTY AT

5123 Crystal Bay Drive

Houston

(Street Address and City)

Hunter's Park Community Association, 281-462-1216, www.bearcreeknetwork.org

(Name of Property Owners Association, (Association) and Phone Number)

A. SUBDIVISION INFORMATION: "Subdivision Information" means: (i) a current copy of the restrictions applying to the subdivision and bylaws and rules of the Association, and (ii) a resale certificate, all of which are described by Section 207.003 of the Texas Property Code.

(Check only one box):

- 1. Within _____ days after the effective date of the contract, Seller shall obtain, pay for, and deliver the Subdivision Information to the Buyer. If Seller delivers the Subdivision Information, Buyer may terminate the contract within 3 days after Buyer receives the Subdivision Information or prior to closing, whichever occurs first, and the earnest money will be refunded to Buyer. If Buyer does not receive the Subdivision Information, Buyer, as Buyer's sole remedy, may terminate the contract at any time prior to closing and the earnest money will be refunded to Buyer.
- 2. Within _____ days after the effective date of the contract, Buyer shall obtain, pay for, and deliver a copy of the Subdivision Information to the Seller. If Buyer obtains the Subdivision Information within the time required, Buyer may terminate the contract within 3 days after Buyer receives the Subdivision Information or prior to closing, whichever occurs first, and the earnest money will be refunded to Buyer. If Buyer, due to factors beyond Buyer's control, is not able to obtain the Subdivision Information within the time required, Buyer may, as Buyer's sole remedy, terminate the contract within 3 days after the time required or prior to closing, whichever occurs first, and the earnest money will be refunded to Buyer.
- 3. Buyer has received and approved the Subdivision Information before signing the contract. Buyer does does not require an updated resale certificate. If Buyer requires an updated resale certificate, Seller, at Buyer's expense, shall deliver it to Buyer within 10 days after receiving payment for the updated resale certificate from Buyer. Buyer may terminate this contract and the earnest money will be refunded to Buyer if Seller fails to deliver the updated resale certificate within the time required.
- 4. Buyer does not require delivery of the Subdivision Information.

The title company or its agent is authorized to act on behalf of the parties to obtain the Subdivision Information ONLY upon receipt of the required fee for the Subdivision Information from the party obligated to pay.

B. MATERIAL CHANGES. If Seller becomes aware of any material changes in the Subdivision Information, Seller shall promptly give notice to Buyer. Buyer may terminate the contract prior to closing by giving written notice to Seller if: (i) any of the Subdivision Information provided was not true; or (ii) any material adverse change in the Subdivision Information occurs prior to closing, and the earnest money will be refunded to Buyer.

C. FEES AND DEPOSITS FOR RESERVES: Buyer shall pay any and all Association fees, deposits, reserves, and other charges associated with the transfer of the Property not to exceed \$ 500.00 and Seller shall pay any excess. This paragraph does not apply to: (i) regular periodic maintenance fees, assessments, or dues (including prepaid items) that are prorated by Paragraph 13, and (ii) costs and fees provided by Paragraphs A and D.

D. AUTHORIZATION: Seller authorizes the Association to release and provide the Subdivision Information and any updated resale certificate if requested by the Buyer, the Title Company, or any broker to this sale. If Buyer does not require the Subdivision Information or an updated resale certificate, and the Title Company requires information from the Association (such as the status of dues, special assessments, violations of covenants and restrictions, and a waiver of any right of first refusal), Buyer Seller shall pay the Title Company the cost of obtaining the information prior to the Title Company ordering the information.

NOTICE TO BUYER REGARDING REPAIRS BY THE ASSOCIATION: The Association may have the sole responsibility to make certain repairs to the Property. If you are concerned about the condition of any part of the Property which the Association is required to repair, you should not sign the contract unless you are satisfied that the Association will make the desired repairs.

Buyer

Signed by:

Seller **Caleb M. Karshner**

Buyer

Signed by:

Seller **Atlanta N. Karshner**



The form of this addendum has been approved by the Texas Real Estate Commission for use only with similarly approved or promulgated forms of contracts. Such approval relates to this contract form only. TREC forms are intended for use only by trained real estate licensees. No representation is made as to the legal validity or adequacy of any provision in any specific transactions. It is not intended for complex transactions. Texas Real Estate Commission, P.O. Box 12188, Austin, TX 78711-2188, (512) 936-3000 (www.trec.texas.gov) TREC No. 36-10. This form replaces TREC No. 36-9.



DISCLOSURE OF RELATIONSHIP WITH CONTRACT PROVIDER OR ADMINISTRATOR

RESIDENTIAL SERVICE CONTRACTS. A residential service contract is a product under which a residential service contract provider or administrator (Provider), for a fee, agrees to repair or replace certain equipment or items in a property. Co-payments typically apply to most service calls. Providers are licensed and regulated by the Texas Department of Licensing and Regulation. The extent of coverage and the cost of coverage will vary. Before buying a residential service contract, the buyer should read the contract and consider comparing it with the extent of coverage and costs from several other Providers. **YOU MAY CHOOSE ANY PROVIDER.**

THE PURCHASE OF A RESIDENTIAL SERVICE CONTRACT IS OPTIONAL. The TREC promulgated residential contract forms contain a paragraph in which the parties may negotiate whether the seller will reimburse the buyer the cost of a residential service contract. The choice of the Provider and extent of coverage lies with the buyer. **NEITHER A BROKER/SALES AGENT NOR A SELLER MAY CONDITION THE SALE OF A PROPERTY ON THE BUYER'S PURCHASE OF A RESIDENTIAL SERVICE CONTRACT.**

- | | |
|---|---|
| <input type="checkbox"/> Other Broker/Sales Agent will receive no compensation from a Provider. | <input checked="" type="checkbox"/> Listing Broker/Sales Agent will receive no compensation from a Provider. |
| <input type="checkbox"/> Other Broker/Sales Agent receives compensation from the following Provider:

for providing the following services:
_____ | <input type="checkbox"/> Listing Broker/Sales Agent receives compensation from the following Provider:
<u>N/A</u>

for providing the following services:
<u>N/A</u>
_____ |



The compensation is not contingent upon a party to the real estate transaction purchasing a contract or services from the Provider.

The compensation is the fee for the services that Listing Broker or Other Broker, either directly or through an agent, provides to the company. As required by the Real Estate Settlement Procedures Act and HUD Regulation X, any fees paid to a settlement services provider are limited to the reasonable value of services actually rendered.

Other Broker's Name _____ License No. _____
By: _____

Jane Byrd Properties International, LLC
Listing Broker's Name **9005146** License No. _____
By: 
Timothy R. Adams

The undersigned acknowledges receipt of this notice:
Buyer _____
Buyer _____

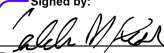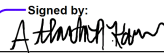Signed by: 
Seller: **Caleb M. Karshner**
Signed by: 
Seller: **Atlanta N. Karshner**



This form has been approved by the Texas Real Estate Commission (TREC) for use by license holders to disclose payments received from a residential contract provider or administrator. Texas Real Estate Commission, P.O. Box 12188, Austin, TX 78711-2188, (512) 936-3000 (<http://www.trec.texas.gov>) RSC-4.

(This notice is to be furnished to a prospective buyer/tenant at such time as broker begins assisting buyer/tenant to locate a property.)

BROKER NOTICE TO BUYER/TENANT

As a prospective buyer/tenant, you should know that the listing and cooperating ("selling") brokers and any broker representing you as a buyer's/tenant's broker, possess no special skills, knowledge or expertise concerning the physical or environmental condition of the property or properties introduced to you nor do they represent themselves to be such experts, and, therefore, make no representations, warranties or guaranties regarding the physical or environmental condition of any such property.

Environmental Hazards/Inspection

As the result of concerns regarding environmental hazards (including, but not limited to, asbestos, lead-based paint, mold, urea formaldehyde insulation, radon gas, PCB transformers, underground storage tanks, electromagnetic fields, hazardous or toxic waste and materials, ammonium compounds, solvents, pesticides, acids, DDT, and any other substance on or about the property or forming a component part of the improvements which has heretofore or may in the future be determined to contain toxic or hazardous materials or undesirable substance injurious to the health of occupants of a property), it is recommended that you retain the services of a qualified expert of your choice to inspect and test for the presence of environmental hazards on or about the property as part of the contract between seller and buyer in a sale transaction or a lease between landlord and tenant, if desired. Buyer/Tenant shall be solely responsible for retaining the services of such expert, if any.

Physical Condition/Inspection

You are advised that you should thoroughly inspect the property and have the physical condition of the property inspected by persons of your choice who are licensed as inspectors by the Texas Real Estate Commission or otherwise permitted by law to perform inspections and take whatever other action you deem necessary or appropriate as part of the contract between seller and buyer in a sale transaction or a lease between landlord and tenant. If you request broker to furnish a list of inspectors and/or repairmen, broker is not making any representations or warranties as to the capabilities or workmanship of such persons. You are advised to accompany the inspectors during their inspection of the property and to ask any questions you may have regarding the property. You are advised to walk through and visibly inspect the property immediately prior to the closing in a sale transaction or occupancy in a lease transaction. In the event the condition of the property is not then in accordance with the contract/lease, you should immediately inform the below-named Broker.

MLS/CIE Information

Information contained in the Multiple Listing Service (MLS), or Commercial Information Exchange (CIE) of Houston Realtors Information Service, Inc. ("HRIS"), a subsidiary of Houston Association of REALTORS®, Inc., is furnished by (1) MLS, and CIE participants who acquire the information from sources such as owners of listed properties, appraisers, and builders, and (2) county appraisal districts and tax services. The information is disseminated to MLS and CIE participants for their exclusive use and display to their clients and customers. Certain information in MLS and CIE such as square footage, assessed value, taxes, and year built is obtained from either the county appraisal district, an appraiser or builder. Neither the listing Broker, Broker displaying the information to you, HRIS, MLS, nor CIE represents or verifies the accuracy of the information. You should not rely upon any information contained in MLS and CIE and you should independently verify such information. You are further advised that MLS rules require the listing Broker of a sold/leased property to submit all information the MLS requires for participation, including the sales price/rent of a property purchased/leased by you.

Selling Broker or buyer's/tenant's broker, if any, shall furnish Listing Broker with a signed copy of this notice at the time the contract/lease is submitted.

I certify that I have provided the prospective Buyer/Tenant named herein with a copy of this "Broker Notice to Buyer/Tenant."

I have received, read and understand the information in this "Broker Notice to Buyer/Tenant."

Date

Buyer/Tenant Name

Broker/Sales Agent Name

Signature

Signature

Buyer/Tenant Name

Company

Signature

Address

Address

Phone

Phone

HAR 410 1/03