

True Grit Home Inspection

Property Inspection Report



Inspector: Brandon Courmier

TREC 22460, TDLR MAC1497, TDA 0789621

25410 Morgan Dr, Tomball, TX 77375

Phone: 832.418.1270

Email: brandon@truegrithomeinspection.com

29055 Pearl Barley Way, Hockley, TX 77447

Inspection prepared for: Deandre Living

Real Estate Agent: -

Date of Inspection: 10-31-2025 Time: 2:00 PM

Age of Home: 2024 Size: 1984

Weather: 70f clear

103125BC2

Home inspection

PROPERTY INSPECTION REPORT FORM

<u>Deandre Living</u> <i>Name of Client</i>	<u>10-31-2025</u> <i>Date of Inspection</i>
<u>29055 Pearl Barley Way, Hockley, TX 77447</u> <i>Address of Inspected Property</i>	
<u>Brandon Courmier</u> <i>Name of Inspector</i>	<u>TREC 22460, TDLR MAC1497, TDA 0789621</u> <i>TREC License #</i>
<u></u> <i>Name of Sponsor (if applicable)</i>	<u></u> <i>TREC License #</i>

PURPOSE OF INSPECTION

A real estate inspection is a visual survey of a structure and a basic performance evaluation of the systems and components of a building. It provides information regarding the general condition of a residence at the time the inspection was conducted. It is important that you carefully read ALL of this information. Ask the inspector to clarify any items or comments that are unclear.

RESPONSIBILITY OF THE INSPECTOR

This inspection is governed by the Texas Real Estate Commission (TREC) Standards of Practice (SOPs), which dictates the minimum requirements for a real estate inspection.

The inspector IS required to:

- use this Property Inspection Report form for the inspection;
- inspect only those components and conditions that are present, visible, and accessible at the time of the inspection;
- indicate whether each item was inspected, not inspected, or not present;
- indicate an item as Deficient (D) if a condition exists that adversely and materially affects the performance of a system or component **OR** constitutes a hazard to life, limb or property as specified by the SOPs; and
- explain the inspector's findings in the corresponding section in the body of the report form.

The inspector IS NOT required to:

- identify all potential hazards;
- turn on decommissioned equipment, systems, utilities, or apply an open flame or light a pilot to operate any appliance;
- climb over obstacles, move furnishings or stored items;
- prioritize or emphasize the importance of one deficiency over another;
- provide follow-up services to verify that proper repairs have been made; or
- inspect system or component listed under the optional section of the SOPs (22 TAC 535.233).

RESPONSIBILITY OF THE CLIENT

While items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions, in the event that any further evaluations are needed, it is the responsibility of the client to obtain further evaluations and/or cost estimates from qualified service professionals regarding any items reported as Deficient (D). It is recommended that any further evaluations and/or cost estimates take place prior to the expiration of any contractual time limitations, such as option periods.

Please Note: Evaluations performed by service professionals in response to items reported as Deficient (D) on the report may lead to the discovery of additional deficiencies that were not present, visible, or accessible at the time of the inspection. Any repairs made after the date of the inspection may render information contained in this report obsolete or invalid.

REPORT LIMITATIONS

This report is provided for the benefit of the named client and is based on observations made by the named inspector on the date the inspection was performed (indicated above).

ONLY those items specifically noted as being inspected on the report were inspected.

This inspection IS NOT:

- a technically exhaustive inspection of the structure, its systems, or its components and may not reveal all deficiencies;
- an inspection to verify compliance with any building codes;
- an inspection to verify compliance with manufacturer's installation instructions for any system or component and DOES NOT imply insurability or warrantability of the structure or its components.

NOTICE CONCERNING HAZARDOUS CONDITIONS, DEFICIENCIES, AND CONTRACTUAL AGREEMENTS

Conditions may be present in your home that did not violate building codes or common practices in effect when the home was constructed but are considered hazardous by today's standards. Such conditions that were part of the home prior to the adoption of any current codes prohibiting them may not be required to be updated to meet current code requirements. However, if it can be reasonably determined that they are present at the time of the inspection, the potential for injury or property loss from these conditions is significant enough to require inspectors to report them as Deficient (D). Examples of such hazardous conditions include:

- malfunctioning, improperly installed, or missing ground fault circuit protection (GFCI) devices and arc-fault (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

Please Note: items identified as Deficient (D) in an inspection report DO NOT obligate any party to make repairs or take other actions. The decision to correct a hazard or any deficiency identified in an inspection report is left up to the parties to the contract for the sale or purchase of the home.

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR**TRUE GRIT HOME INSPECTION, PLLC. SERVICE AGREEMENT****THIS IS INTENDED TO BE A LEGALLY BINDING CONTRACT****BETWEEN YOU THE CLIENT AND TRUE GRIT HOME INSPECTION, PLLC. , ITS SUBSIDIARIES,
AND ALL SUBCONTRACTORS SCHEDULED OR ARRANGED THROUGH US****PLEASE READ CAREFULLY**

1. **SCOPE OF THE INSPECTION:** The inspector will perform a general, non-Invasive limited visual ("eyeball") inspection of the property structure at the address listed below to provide Client(s) with a written opinion as to the apparent general condition of the structure(s) components and systems at the time of the inspection. The inspection will be performed in a manner consistent with the "Standard of Practice" and "Code of Ethics" of "TREC" Texas Real Estate Commission and prepare a written report of the apparent condition of the readily accessible systems and components of the Property unless otherwise indicated existing at the time of the inspection. A copy of these Standards are readily available to the Client(s) at

http://www.trec.state.tx.us/inspector/rules_governing_inspectors.asp

Only systems and components that can be reached, entered, or viewed without difficulty, moving obstructions, or requiring any action which may result in damage to the property or personal injury to the Inspector will be inspected. Latent and concealed defects and deficiencies are excluded from the inspection, and Inspector is not liable for latent and concealed defects and deficiencies. Any area which is not exposed to view, concealed, is inaccessible because of soil, walls, floors, carpets, ceilings, furnishings or other things, or areas/items which have been excluded by "TREC" Texas Real Estate Commission standards and/or by the agreement of the parties is not included in this inspection. The inspection does not include any destructive testing or dismantling. In the event that the property is a part of a condominium unit, such inspection will not include any other connected or external portions of a multi-unit building or any common areas covered by a joint use agreement or considered common areas.

2. **STANDARDS OF PRACTICE:** The parties agree that the Standards of Practice "TREC" Texas Real Estate Commission shall define the standard of duty and the conditions, limitations, scope, and exclusions of the inspection and are incorporated by reference herein.

3. **CLIENT'S DUTY:** Client agrees to read the entire report when it is received and promptly call the

Inspector with any question or concern regarding the inspection or written report. The written report shall be the final exclusive findings of the Inspector. In the event client becomes aware of a reportable condition which was not reported by the Inspector, Client agrees to promptly notify Inspector and allow Inspector and/or Inspector's designated representative(s) to inspect said condition(s) before making any repair, alteration, or replacement.

4. **FURTHER EVALUATION:** Client acknowledges and agrees that the Inspector is a generalist and that further investigation of a reported condition by an appropriate certified licensed specialist may provide additional information that may affect a Client(s) decision to purchase the home. Client should seek further evaluation from licensed professionals regarding the deficiencies identified in the written report. Inspector is not liable for Client(s) failure to further investigate reported deficiencies.

5. **CHANGE IN CONDITION(S):** The parties agree and understand that conditions of systems and components may change between the inspection date and the time of closing. It is the Client's responsibility to further investigate before closing and the Inspector is not liable for any changes of conditions.

6. **NOT A WARRANTY:** The parties agree and understand the Inspector is not an insurer or guarantor against defects in the structure, items, components, or systems inspected. Client(s) understand that the inspection and inspection report does not constitute a guarantee or warranty of merchantability or fitness for a particular purpose, expressed or implied, or insurance policy, nor is it a substitute for real estate transfer disclosures which may be required by law. **INSPECTOR MAKES NO WARRANTY, EXPRESS OR IMPLIED, AS TO THE PRESENT OR FUTURE FITNESS FOR USE, CONDITION, PERFORMANCE OR ADEQUACY OF ANY INSPECTED STRUCTURE, ITEM, COMPONENT, OR SYSTEM, THE PRESENCE OR ABSENCE OF LATENT OR HIDDEN DEFECTS THAT ARE NOT REASONABLY ASCERTAIN IN A COMPETENTLY PERFORMED HOME INSPECTION, OR THE REMAINING USEFUL LIFE OF ANY SYSTEM OR COMPONENT OF THE PROPERTY.**

7. **NOT AN APPRAISAL:** The Inspection will not include an appraisal of the value or a survey of building and/or property lines. This inspection or the inspection report may not be construed as an appraisal or survey and may not be used as such for any purpose.

8. **NOT A COMPLIANCE INSPECTION:** This inspection or inspection report is NOT a code compliance inspection or certification for past or present governmental codes or regulations.

9. **INSURABILITY:** The inspection or inspection report does not determine whether the property is insurable.

10. **THIRD PARTIES AND SUBROGATION:** The inspection and written report are performed and prepared for the sole and exclusive use and possession of the Client. No other person or entity may rely on the report issued pursuant to this Agreement. In the event that any person, not a party to this Agreement, makes any claim against the Inspector, its employees or agents, arising out of the services performed by the Inspector under this Agreement, or claims alleging in whole or part any negligent act or omission of the Inspector, the Client agrees to indemnify, defend, and hold harmless Inspector from any and all damages, expenses, costs, and attorney fees, arising from such a claim.

11. **LIMITATION OF LEGAL ACTION:** The parties agree that any legal action must be brought within one (1) year from the date of the inspection(s), or will be deemed waived and forever barred.

12. **LIABILITY:** The parties agree that True Grit Home Inspection, PLLC. and its employees and its agents assume no liability or responsibility for cost of repairing or replacing any defects specified in the written report, as well as no liability for the costs of further evaluation or investigation of the defects specified in the written report. Further, the parties agree and understand that the Inspector and its employees and its agents assume no liability for the costs of repairing or replacing any of the unreported defects or deficiencies either current or arising in the future or any property damage, consequential damage or bodily injury of any nature. In the event of a claim by the Client that an installed system, or component of the premises which was inspected by the inspector was not in the condition reported by the Inspector, the Client agrees to notify the Inspector at least 72 hours prior to repairing or replacing such system or component. If repairs or replacement are done without giving the Inspector the required notice, the Inspector will have no liability to the client. Client agrees that prior to taking any action, legal or otherwise, Client shall: submit a written claim to Inspection Company within 10 days of the deficiency discovery to 25410 Morgan Dr, Tomball TX 77375. The written claim shall describe the suspected deficiency. Allow the Inspection Company, their agent or legal representative to perform a re-inspection of the deficiencies stated in the claim. Agree to not to disturb or repair the disputed item prior to a re-inspection except in cases where injury or subsequent property damage may occur.

13. **DISPUTES AND ARBITRATION** In the event a dispute arises regarding an inspection that has been performed under this service agreement, Client(s) agree to notify True Grit Home Inspection, PLLC. within ten (10) days of the time of discovery to give True Grit Home Inspection, PLLC. a reasonable opportunity to re-inspect the property and resolved the dispute amicably. Upon the request of either party, all unresolved disputes relating to this agreement shall be submitted for arbitration in accordance with (AAA) American Association of Arbitrators and pursuant to the Federal Arbitration Act then in effect with costs shared equally. This provision shall be specifically enforceable and damages for breach of this provision shall include but not limited to court costs and attorney's fees. Client agrees that True Grit Home Inspection, PLLC. and its agents' liability, if any, shall be limited to the amount of the inspection fee paid for inspection. This limitation shall apply regardless of the cause of action or the legal theory pled or asserted specifically including, but not limited to, negligence.

14. **SEVERABILITY:** If any court of competent jurisdiction determines that any section, provision or part of this Agreement is void, unenforceable, or contrary to Texas law, the remaining sections of this Agreement shall remain in full force and effect.

15. **DAMAGES:** If the inspection company or any of its employees, agents, providers, officers, members, or shareholders, are found to be liable for any claim or damage due to the alleged negligence or willful misconduct of the Inspection company performing the home inspection or in the reporting on the condition of the property in the inspection report, **THE MAXIMUM DAMAGE THAT THE CLIENT CAN RECOVER SHALL NOT EXCEED THE COST OF THE INSPECTION FEE PAID BY THE CLIENT.** The Inspection Company shall not be liable to the Client for any loss of use of the property, repair or replacement cost, consequential or punitive damages or for attorneys' fees or court costs. The Inspection Company shall not be liable to the Client for any claims, loss or damage if the Client alters, tampers with or repairs or replaces the condition which is the subject matter of the Client's claim before the Inspection Company has had an opportunity to inspect the alleged defective condition.

16. **CLIENT UNDERSTANDS:** The integrity and moisture content of framing and sheathing behind finished wall coverings (exterior siding, stucco, cement stone coverings, fiber cement siding, drywall, interior bath and shower tile walls, etc) is not visible to inspect and beyond the scope of our services and is excluded within our services and is excluded within our inspection and inspection report. The lack of proper detailing and flashing may result in water penetration behind siding resulting in water penetration and structural damage which True Grit Home Inspection, PLLC makes no guarantee, warranty, or implied in the inspection or inspection report.

17. **EXPERT TESTIMONY / LITIGATION FINANCIAL COMPENSATION CLAUSE:** In the event our services are needed at any time in the future as expert testimony or in a litigation case, client agrees at this time / in advance to financially compensate this firm for it's time and services. Terms: Non-refundable retainer of \$2,500.00 upfront, Hourly rate of \$175.00 for any activities on our part for your case, including but not limited to; deposition, phone time, research, court time, travel time portal to portal, review of case prior to court appearance, etc. Balance due invoiced weekly, submitted Friday, payable the next Friday

18. **RE-INSPECTIONS:** True Grit Home Inspection, PLLC does not normally conduct re-inspection services. We are not in the business of certifying the workmanship and/or warranting another company's repair work. Receipts and/or warranty for work performed should be obtained from the company or companies who have provided repairs. In the event a re-inspection is performed it is agreed to in advance that True Grit Home Inspection, PLLC does not assume responsibility of any kind for another company's work.

19. **LIMITATION AND EXCLUSION CLAUSE:** The Client expressly acknowledges and agrees that the following are not included in the scope of the inspection and the inspection report and further acknowledges that the Inspector makes no representations or warranties as to them. **THE FOLLOWING SYSTEMS, ITEMS, AND CONDITIONS WHICH ARE NOT WITHIN THE SCOPE OF THE BUILDING INSPECTION INCLUDE BUT ARE NOT LIMITED TO:** recreational, leisure, playground or decorative equipment or appliances including but not limited to pools, hot tubs, saunas, steam baths, landscape lighting, fountains, shrubs, trees, and tennis courts. Cosmetic conditions wallpapering, painting, carpeting, scratches, scrapes, dents, cracks, stains, soiled or faded surfaces on the structure ,equipment or component, soiled, faded, torn, or dirty floor, wall or window coverings, etc. Noise pollution or air quality. Earthquake hazard, flood plain certification, liquefaction, soil, retaining walls, slide potential, wave action and hydrological stability, soil and earth measurements and stability, seismic safety, code and zoning, engineer level analysis, underground

utilities, sink hole potential, formaldehyde, lead paint, asbestos, toxic or flammable materials, molds, mildew, fungi, other environmental hazards, pest infestation, security systems, fire protection systems, sump pumps, household appliances, humidifiers, paint, other treatment windows, interior walls, ceilings and floors, water purification systems, (ozone generator/saltwater, etc), underground storage tanks, energy efficiency measurements, motion or photo electric sensor lighting, concealed or private security systems, water wells, all over flow drains, heating system's accessories, solar heating systems, heat exchangers, wood burning stoves, sprinkler systems, water softener or purification systems, central vacuum systems, telephone intercom or cable TV systems, internet connections and cable connections, antennae, lightning arrestors, load controllers, governing codes, permits, ordinances, statues, and covenants, and manufacturer specifications, recalls, EIFS, Chinese drywall and tainted materials, plasterboard, sheet rock, gypsum board, latent and concealed defects, and manufactured stone veneer, culture stone siding, fiber cement siding, flues or chimneys, coal stoves, water leaks, water intrusion, design and architect problems, circuit breaker operation, fireplace drafting, boundaries egress and ingress, quality of materials, private sewage, wattage and wiring, electromagnetic field, non-built in appliances, rodents, ants, birds, or other wood boring organisms, security locks and devices, thermostat and gauges. Client understands that these systems, items, and conditions, are excepted and excluded from this inspection and Inspection report. Any general comments about these systems, items, and conditions of the written report are informal only and DO NOT REPRESENT AN INSPECTION.

20. THIRD PARTY SERVICE PROVIDERS: YOUR INSPECTOR MAY HAVE AN AFFILIATION WITH A THIRD PARTY SERVICE PROVIDER ("TPSP") IN ORDER TO OFFER YOU ADDITIONAL VALUE- ADDED SERVICES. BY ENTERING INTO THIS AGREEMENT YOU (A) AUTHORIZE YOUR INSPECTOR TO PROVIDE YOUR CONTACT INFORMATION (INCLUDING TELEPHONE NUMBER) TO THE TPSP, (B) WAIVE AND RELEASE ANY RESTRICTIONS THAT MAY PREVENT THE TPSP FROM CONTACTING YOU (INCLUDING BY TELEPHONE USING AUTOMATED DIALING TECHNOLOGY), AND (C) AUTHORIZE THE TPSP TO CONTACT YOU (INCLUDING BY TELEPHONE) REGARDING SPECIAL HOME ALARM SYSTEM OFFERS.

21. PERSONAL SAFETY: We are not responsible for another participant's personal safety during the inspection process. Client, their representative's, or others participation shall be at his/her own risk for falls, injuries, property damage, etc. We reserve the right to refuse service to anyone for any reason.

22. This Agreement, including the terms and conditions on all pages, represents the entire agreement between the parties and there are no other agreements either written or oral between them. This Agreement shall be amended only by written agreement signed by both parties.

23. ACKNOWLEDGMENT: the undersigned has reviewed this document, understands its content and agrees to the terms and conditions contained. The client further represents and warrants that he or she has full and complete authority to execute this contract on behalf of any spouse or significant other, and to fully bind any spouse or significant other to all terms, conditions, exclusions and limitations of this agreement.

If after walking thru the property with the inspector, if you are in anyway dissatisfied with the services provided by True Grit Home Inspection, PLLC., you are under no obligation to pay the inspection fee, but the inspection report will not be delivered. State "three-day right to cancel" may apply.

Table Of Contents

STRUCTURAL SYSTEMS	7-14
ELECTRICAL SYSTEMS	15-16
HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS	17-20
PLUMBING SYSTEMS	21-24
APPLIANCES	25-26
OPTIONAL SYSTEMS	27-28

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

I. STRUCTURAL SYSTEMS

A. Foundations

Type of Foundation(s):

- Slab Foundation

Comments:

- It is my opinion that the foundation is performing as intended, but may still have some deficiencies.
- Corner pop noticed. Corner sections of the foundation are not supported as much as rest of foundation. This is not typically an issue, but take notice if cracks begin to form in bricks or mortar above corner pop.



Corner pop noticed. Corner sections of the foundation are not supported as much as rest of foundation. This is not typically an issue, but take notice if cracks begin to form in bricks or mortar above corner pop.

B. Grading and Drainage

Comments:

- Recommend a Gutter system to aid in drainage away from house.

C. Roof Covering Materials

Type(s) of Roof Covering:

- Composition shingles noted. (25-30 year total estimated life)

Viewed From:

- Ground
- Ariel Images

Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---




I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

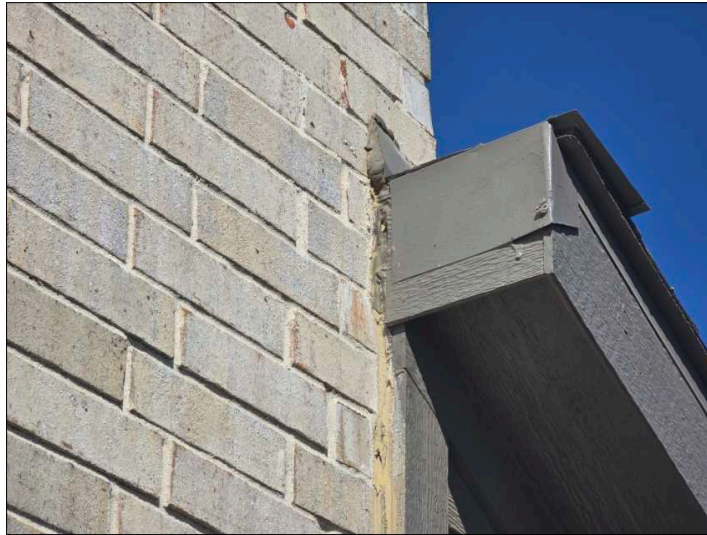

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	-------------------------------------

D. Roof Structure and Attics

Viewed From:

- Ground
- Attic

Approximate Average Depth of Insulation:

- Insulation is 10+ inches deep

Comments:

- Insulation type(s): Blown fiberglass - newer style
- Missing insulation at access panel. Suggest batt insulation stapled to backside.



Missing insulation at access panel. Suggest batt insulation stapled to backside.



Insulation holding panel loose.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Insulation type(s): Blown fiberglass - newer style

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	--------------------------

E. Walls (Interior and Exterior)

Wall Materials:

- Exterior walls are covered with cement fiber board. (Example: HardiePlank, LP Smartside, etc.)
- Exterior walls are made of brick
- Interior walls are made of Drywall

Comments:

- Several cosmetic issues noted. This inspection is not intended to be a cosmetic inspection.
- Open hole in brick around gas line.
- Open holes around porch large enough for pest entry.
- Loose brick found at top corner near garage.



Open hole in brick around gas line.



Loose brick found at top corner near garage.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Open holes around porch large enough for pest entry.

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	-------------------------------------

F. Ceilings and Floors

Ceiling and Floor Materials:

- Ceiling is made of drywall
- Floors have carpet on them.
- Floors are covered with linoleum / vinyl plank.

Comments:

- Minor ceiling crack noted near register in master bathroom.



Minor ceiling crack noted near register in master bathroom.

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	--------------------------

G. Doors (Interior and Exterior)

Comments:

- Exterior door is fully exposed to the weather and elements. A storm door may help protect the door and door frame from accelerated deterioration.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Exterior door is fully exposed to the weather and elements. A storm door may help protect the door and door frame from accelerated deterioration.


<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	H. Windows
-------------------------------------	--------------------------	--------------------------	--------------------------	------------

Window Types:

- Sliding windows.
- Windows are double pane.
- Windows are made of vinyl

Comments:

- Light in window likely cause for small flying bugs collecting.

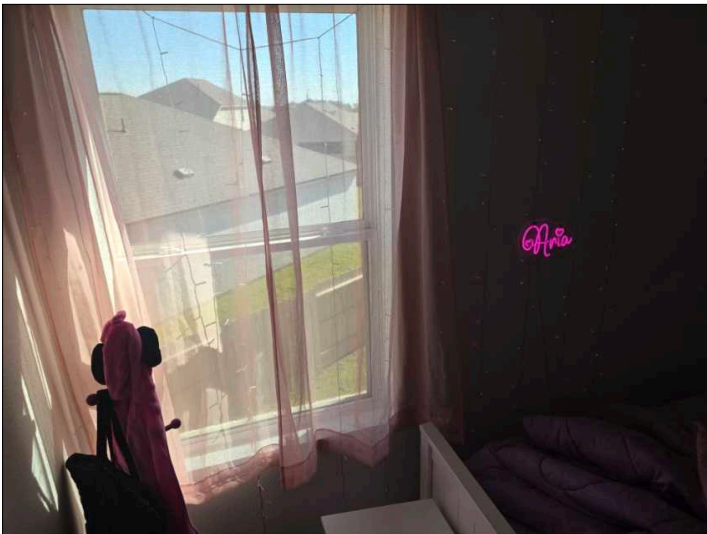

Light in window likely cause for small flying bugs collecting.



Light in window likely cause for small flying bugs collecting.

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	I. Stairways (Interior and Exterior)
-------------------------------------	--------------------------	--------------------------	--------------------------	--------------------------------------

Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
--------------------------	--------------------------	-------------------------------------	--------------------------

J. Fireplaces and Chimneys

Locations:

Types:

Comments:

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
--------------------------	--------------------------	-------------------------------------	--------------------------

K. Porches, Balconies, Decks, and Carports


Comments:

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
--------------------------	--------------------------	-------------------------------------	--------------------------

L. Other

Materials:

Comments:

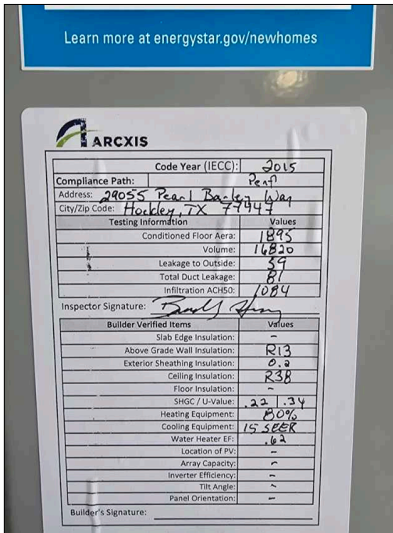

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

II. ELECTRICAL SYSTEMS

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	A. Service Entrance and Panels
-------------------------------------	--------------------------	--------------------------	--------------------------	--------------------------------

Panel Locations:

- Electrical panel is located on the right side of the building if looking at front of house from the street.
- Electrical panel is located in the garage.


Materials and Amp Rating:

- Aluminum Service Entrance Conductors
- 150 Amp Service Entrance

Comments:



Reference Photo

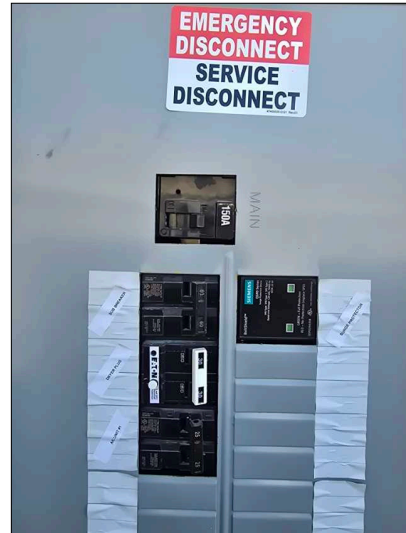

Reference Photo



Reference Photo



Reference Photo

I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Reference Photo

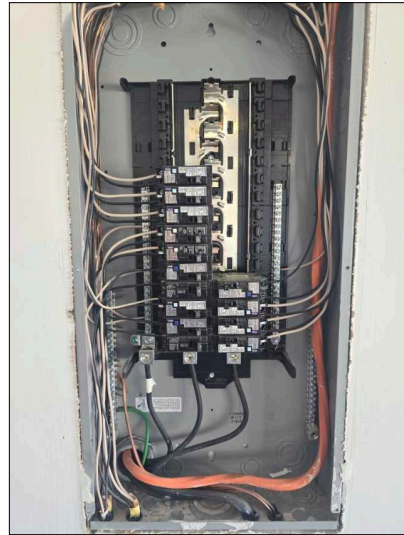

Reference Photo

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	B. Branch Circuits, Connected Devices, and Fixtures
-------------------------------------	--------------------------	--------------------------	--------------------------	---

Type of Wiring:


- Copper wiring
- 15 amp
- 20 amp

Comments:

<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	C. Other
--------------------------	-------------------------------------	--------------------------	--------------------------	----------

Comments:

- Cable, internet, networking, phone and security systems not part of home inspection.

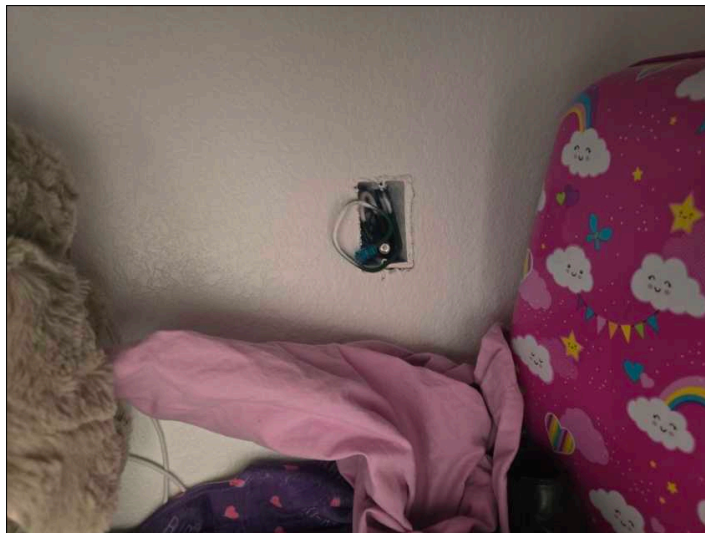

Missing cover at closet network connection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

A. Heating Equipment

Type of Systems:


- Gas fired forced hot air.

Energy Sources:

- The furnace is gas/ fuel powered. 80% AFUE

Comments:

- Furnace visually inspected and checked.
- Estimated Age of Furnace :2024

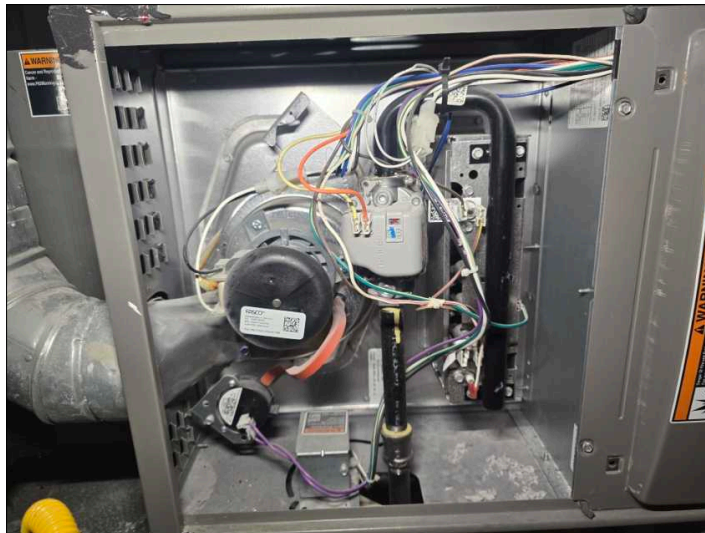

Furnace visually inspected and checked.

B. Cooling Equipment

Type of Systems:

- Split Unit Size: 2.5 ton

Refrigerant: R410A

MFG Dates 2024 coil (inside); 2024 condenser (outside)

Comments:

- Trip switches present inside a/d condenser overflow pan. These detect water and will cause the unit to stop operating.
- Secondary Drain line discharge location is over window. If water is seen coming from here, the primary may be stopped up. Contact HVAC service immediately to prevent possible damage.
- Microbial growth found on outside of HVAC unit. Likely caused by air leakage.

I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient


I	NI	NP	D
---	----	----	---



2.5 ton, R410A, 2024

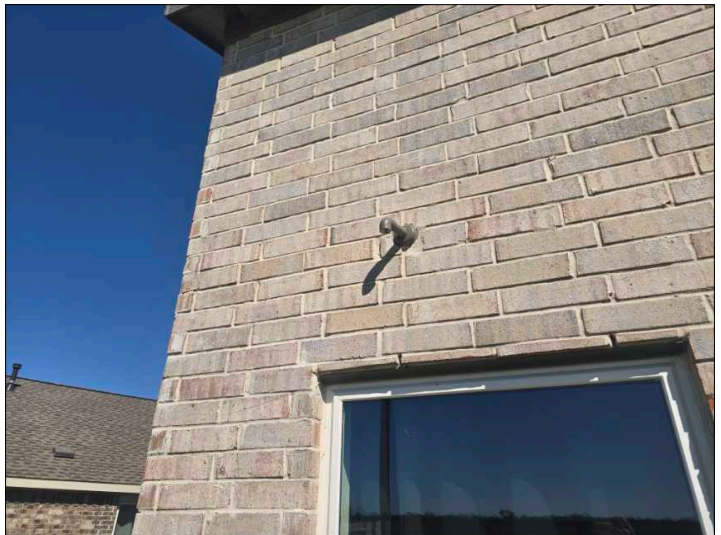

Secondary Drain line discharge location is over window. If water is seen coming from here, the primary may be stopped up. Contact HVAC service immediately to prevent possible damage.

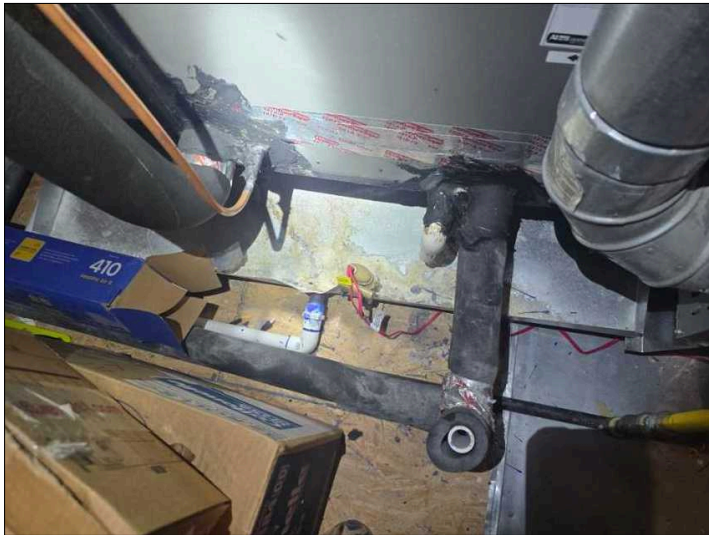

Trip switches present inside a/c condenser overflow pan. These detect water and will cause the unit to stop operating.



Microbial growth found on outside of HVAC unit. Likely caused by air leakage.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



2024 coil



20f delta T across coil is acceptable.




C. Duct Systems, Chases, and Vents


Comments:

- Registers are dirty.
- Fresh air intake system present and appears functional. Clean internal filter annually.
- Air leakage under registers. Noted via thermal camera. Not sealed to ceiling.
- Evidence of rust and some mildew growth at plenum. Excess moisture in system and air leakage may cause this formation.

Up loft

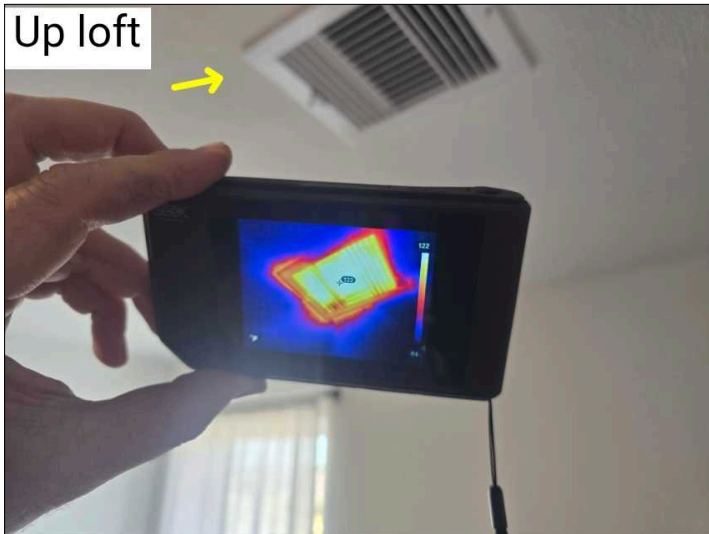

Air leakage under registers. Noted via thermal camera. Not sealed to ceiling.

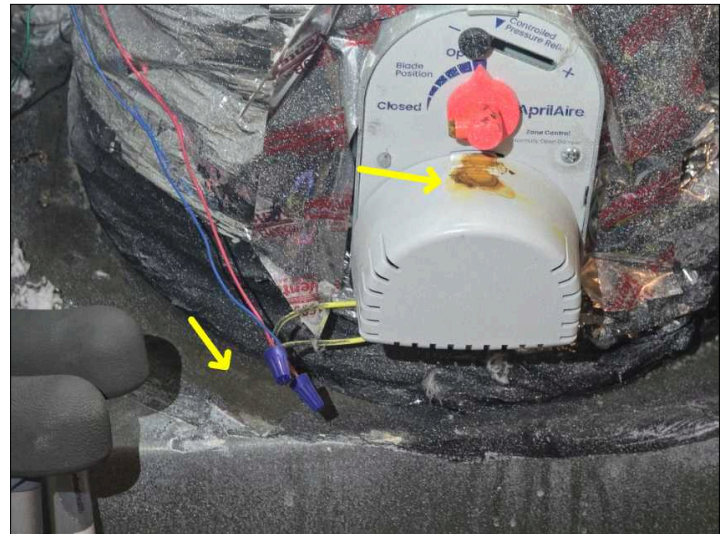

Evidence of rust and some mildew growth at plenum. Excess moisture in system and air leakage may cause this formation.

I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Fresh air intake system present and appears functional. Clean internal filter annually.

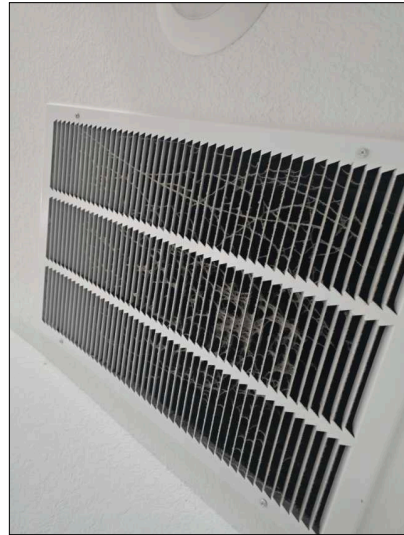

Registers are dirty.

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	D. Other
--------------------------	--------------------------	-------------------------------------	--------------------------	----------

Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

IV. PLUMBING SYSTEMS

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	A. Plumbing Supply, Distribution System and Fixtures
-------------------------------------	--------------------------	--------------------------	-------------------------------------	--

Location of Water Meter: Front of structure near street.


Location of Main Water Supply Valve:

Comments:

- Master bath faucet has reduced flow. Repairs needed for blockage / internal damage.



Master bath faucet has reduced flow. Repairs needed for blockage / internal damage.

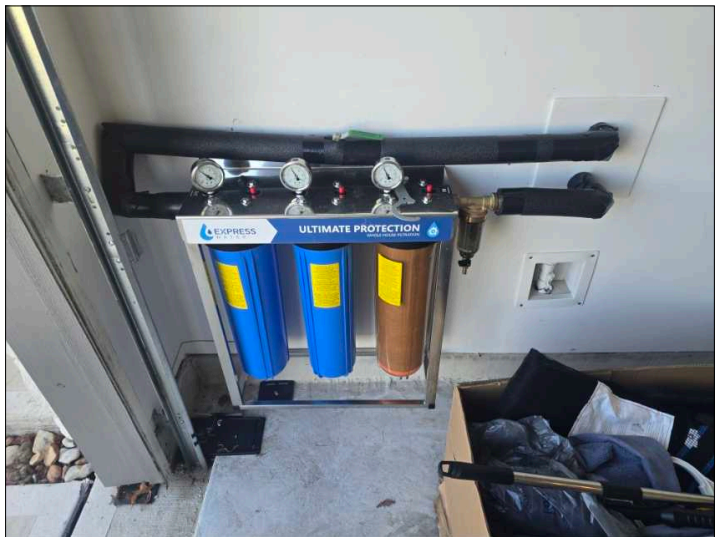

Filter system not tested

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	B. Drains, Wastes, and Vents
-------------------------------------	--------------------------	--------------------------	--------------------------	------------------------------

Comments:

- Type of Drain Piping Material: PVC / Plastic

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



Cleanout location



Poorly placed plumbing cleanouts.

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
-------------------------------------	--------------------------	--------------------------	--------------------------

C. Water Heating Equipment

Energy Source:

- Water heater is gas powered
- Water heater is located in the garage

Capacity:

- Tankless style.

Comments:

- Estimated MFG year of water heater : 2024
- Drip pan missing from under unit. Pan and drain should be installed when house damage can occur from a leaking water heater.
- Water heater vent and drain lines. If water is seen coming from here, contact plumber for evaluation.


I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

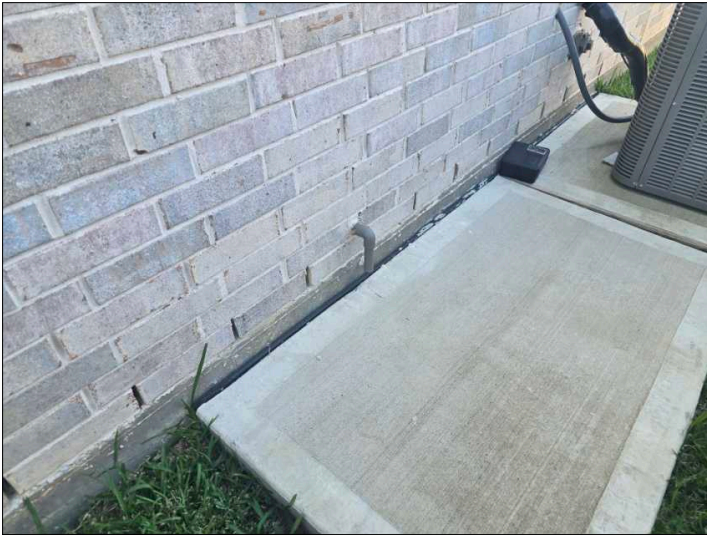

Water heater vent and drain lines. If water is seen coming from here, contact plumber for evaluation.



Drip pan missing from under unit. Pan and drain should be installed when house damage can occur from a leaking water heater.

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	D. Hydro-Massage Therapy Equipment
--------------------------	--------------------------	-------------------------------------	--------------------------	------------------------------------

Comments:

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	E. Gas Distribution Systems and Gas Appliances
-------------------------------------	--------------------------	--------------------------	--------------------------	--

Location of Gas Meter:

- Right side of house

Type of Gas Distribution Piping Material:

- Steel- black pipe

Comments:

- Gas Meter and Shutoff Location.



Gas Meter and Shutoff Location.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	F. Other
--------------------------	--------------------------	-------------------------------------	--------------------------	----------

Materials:
Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

V. APPLIANCES

A. Dishwashers

Comments:
 • Operated.

B. Food Waste Disposers

Comments:
 • Operated - appeared functional at time of inspection.

C. Range Hood and Exhaust Systems

Comments:
 • Operated.

D. Ranges, Cooktops, and Ovens

Comments:

E. Microwave Ovens

Comments:

F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:
 • Exhaust vents are dirty. Recommend having cleaned out.



Exhaust vents are dirty. Recommend having cleaned out.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

G. Garage Door Operators

Door Type:


- One 16' steel door
- Sectional door noted.

Comments:

H. Dryer Exhaust Systems

Comments:

- Could not fully inspect the dryer vent, due to access.
- Suggest cleaning vent annually.

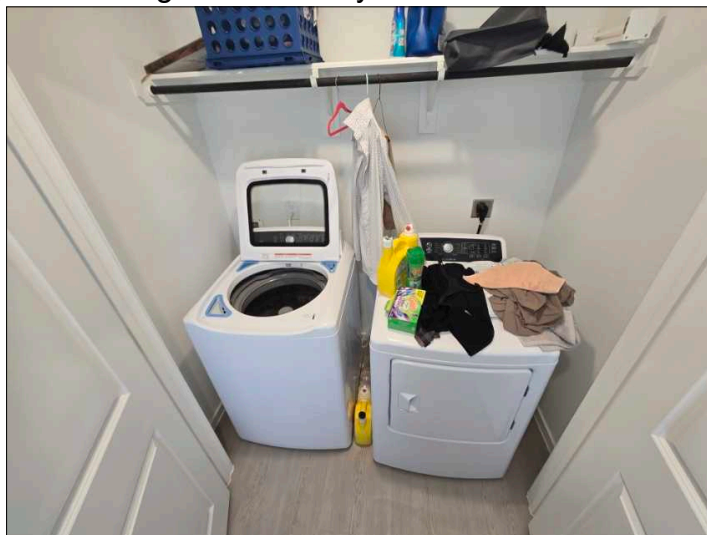

Could not fully inspect the dryer vent, due to access.

I. Other

Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

VI. OPTIONAL SYSTEMS

I
 NI
 NP
 D
 A. Landscape Irrigation (Sprinkler) Systems

Comments:

- NOTE: Backflow preventer should be protected from weather during winter months.
- Damaged sprinkler head. Leaning sideways, left side back yard.



NOTE: Backflow preventer should be protected from weather during winter months.

Damaged sprinkler head. Leaning sideways, left side back yard.

I
 NI
 NP
 D
 B. Swimming Pools, Spas, Hot Tubs, and Equipment

Type of Construction:

Comments:

I
 NI
 NP
 D
 C. Outbuildings

Materials:

Comments:

I
 NI
 NP
 D
 D. Private Water Wells (A coliform analysis is recommended)

Type of Pump:

Type of Storage Equipment:

Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	E. Private Sewage Disposal Systems
--------------------------	--------------------------	-------------------------------------	--------------------------	------------------------------------

Type of System:
Location of Drain Field:
Comments:

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	F. Other Built- in Appliances
--------------------------	--------------------------	-------------------------------------	--------------------------	-------------------------------

Observations:

<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	G. Other
--------------------------	--------------------------	-------------------------------------	--------------------------	----------

Comments: